



Tree Risk Management Appraisal

at



**Throstle Nest, Saccary Lane,
Mellor, Lancashire, BB1 9DW**

Prepared by:

Bowland 
Tree Consultancy Ltd

April 2021

TREE RISK MANAGEMENT APPRAISAL THROSTLE NEST, MELLOR

CONTENTS

1. CIVIL LAW REGARDING TREE OWNERSHIP AND DUTY OF CARE
2. QTRA METHODOLOGY OVERVIEW AND APPLICATION IN MANAGEMENT DECISIONS
3. SUMMARY OF SURVEY FINDINGS AND RECOMMENDATIONS
4. TREE SURVEY SCHEDULE
5. TREE SURVEY PLAN
6. QTRA PRACTICE NOTE



Contact Details

Bowland Tree Consultancy Ltd
Unit Two
First Floor
11 Cannon Street
Preston
Lancashire
PR1 3NR

T: 01772 437150
E: info@bowlandtreeconsultancy.co.uk

TREE RISK MANAGEMENT APPRAISAL THROSTEL NEST, MELLOR

Project Details

Project No.: BTC2187

Site: Throstle Nest, Saccary Lane, Mellor, BB1 9DW

Survey Type: Individual Tree Survey

Tree(s) Considered: Those as identified by client during site visit

Report Time Frame: 12 months from date of issue

Next Inspection Date: ≈18 months from date of issue

Client: Helene Andrew

Survey Date: 14 April 2021

Surveyor: Joseph Lambert BSc(Hons) FdSc MArborA

Report Prepared by: Joseph Lambert BSc(Hons) FdSc MArborA

Report Checked by: Phill Harris MSc BSc(Hons) HND MArborA CEnv MICFor

Date of Issue: 26 April 2021

Version No: 1

1. CIVIL LAW REGARDING TREE OWNERSHIP AND DUTY OF CARE

- 1.1 Under civil law the owner of the land on which a tree stands, together with any party who has control over the tree's management, has a duty of care to take reasonable steps to prevent or minimise the risk of personal injury and/or damage to property from any tree located within the curtilage of the land in question.
- 1.2 In turn, it is accepted that these steps should normally include commissioning a qualified and experienced arboriculturist to survey the tree in order to identify and appraise any risk of harm to persons or damage to property that it may present and, where unacceptable risks are identified, taking suitable remedial action to negate or reduce those risks accordingly.

2. QTRA METHODOLOGY OVERVIEW AND APPLICATION IN MANAGEMENT DECISIONS

- 2.1 A survey was carried out in order to consider the general structural stability of the trees at the site and the associated risk of harm that they pose to persons and/or damage that they pose to property and, from this information, to make management recommendations to reduce any risks identified to be unacceptable to a level that is considered to be either tolerable or broadly acceptable (see Table 1, below).
- 2.2 The Quantified Tree Risk Assessment (QTRA) methodology utilised for the tree survey (see appended QTRA Practice Note for more details) quantifies the three components of tree failure risk, which are:
- Target* (something with potential to be harmed and/or damaged by the mechanical failure of tree parts);
 - Impact Potential*; and
 - Probability of Failure* (within the coming year).
- 2.3 The product of the three component values is the annualised 'Risk of Harm', which is a combined measure of the likelihood and the consequence of tree failure considered in terms of the loss within the coming year, and is expressed as a probability. In applying the 'Tolerability of Risk Framework' (ToR) the QTRA methodology divides the 'Risk of Harm' into three threshold values, being;
- Unacceptable* (i.e. >1/1,000), which is unacceptable and will not ordinarily be tolerated;
 - Tolerable* (i.e. between 1/1,000,000 and 1/1,000, where the Risk of Harm will be tolerable if it is As Low As Reasonably Practicable (ALARP); but a Risk of Harm 1/10,000 or greater will not ordinarily be Tolerable where it is imposed on others, such as the public. In the Tolerable range management decisions are informed by consideration of the benefits and costs of risk control, including benefits provided by trees that would be lost to risk control measures; and
 - Broadly Acceptable* (<1/1,000,000), which is already ALARP.
- 2.4 The QTRA advisory thresholds, (see Table 1, below) are proposed as a reasonable approach to balancing safety from falling trees with the costs of risk reduction. This approach takes account of the principles of ALARP and ToR, but does not dictate how these principles should be applied. While the thresholds can be the foundation of a robust policy for tree risk management, tree managers should make decisions based on their own situation, values and resources.

Table 1: QTRA Advisory Risk Thresholds:

Threshold	Description	Action
Risk of harm of 1/1,000 or greater	Unacceptable - Risks will not ordinarily be tolerated	<ul style="list-style-type: none"> ▪ Control the risk
Risk of harm between 1/1,000 and 1/10,000	Unacceptable (where imposed on others) - Risks will not ordinarily be tolerated	<ul style="list-style-type: none"> ▪ Control the risk ▪ Review the risk
	Tolerable (by agreement) Risks may be tolerated if those exposed to the risk accept it, or the tree has exceptional value	<ul style="list-style-type: none"> ▪ Control the risk unless there is broad stakeholder agreement to tolerate it, or the tree has exceptional value ▪ Review the risk
Risk of harm between 1/10,000 and 1/1,000,000	Tolerable (where imposed on others) - Risks are tolerable if ALARP	<ul style="list-style-type: none"> ▪ Assess costs and benefits of risk control ▪ Control the risk only where a significant benefit might be achieved at reasonable cost ▪ Review the risk
Risk of harm less than 1/1,000,000	Broadly Acceptable - Risk is already ALARP	<ul style="list-style-type: none"> ▪ No action currently required ▪ Review the risk

- 2.5 As detailed in Table 1, a Risk of Harm less than 1/1,000,000 is Broadly Acceptable and already ALARP (i.e. 'as low as reasonably practicable'). A Risk of Harm 1/1,000 or greater is unacceptable and will not ordinarily be tolerated. Between these two thresholds, the Risk of Harm is in the Tolerable region of the ToR Framework and will be tolerable if it is ALARP, but a Risk of Harm 1/10,000 or greater will not ordinarily be Tolerable where it is imposed on others, such as the public. Here, management decisions are informed by consideration of the benefits and costs of risk control, including benefits provided by trees that would be lost to risk control measures.
- 2.6 In respect of the above the assessor (i.e. Bowland Tree Consultancy Ltd) may consider the costs of risk control when providing options for management if specifically asked to do so, but the tree owner/manager, who owns the risk and therefore exercises control over the costs, must consider the balance and make the final management decision(s).

3. **SUMMARY OF SURVEY FINDINGS AND RECOMMENDATIONS**

- 3.1 An 'Individual Tree Survey' (see 'Schedule of Operations' appended to agreed project quote) was carried out on 14 April 2021 at the site under consideration. The trees to be considered as part of the survey were identified verbally by the instructing client, Helene Andrew, during the site visit.
- 3.2 The survey identified ten individual trees and four groups of trees. The surveyed trees are in the semi-mature to post-mature age range and have heights of up to 22 metres, have stem diameters of up to 1000 millimetres, and maximum diametrical crown spreads of up to approximately 18 metres.
- 3.3 The site under consideration is a detached residential property and its associated private gardens, inclusive of an area of private woodland to the west. The trees stand within a wooded group to the west of the property and as several individuals within the gardens of the property.
- 3.4 The property is bordered to the east and north-west by neighbouring residential properties and their associated private gardens and driveways, to the north, south and west by the moderate usage Saccary Lane, and to the south-east by access driveways to neighbouring properties. (see appended Tree Survey Plan). A public bridleway runs from north to south through land under the client's ownership separating the residential property and its formal gardens to the east and the wooded area to the site's west.
- 3.5 As a component of this appraisal various targets were identified to be within falling distances of the surveyed trees, including, but not restricted to, vehicles and occupants travelling along the moderate usage Saccary Lane and using the various driveways to access residential properties, pedestrians using the bridleway and using the various driveways to access residential properties, persons using private garden areas of the property and the neighbouring properties, and various item of property including boundary features such as fences and walls and a low voltage overhead power line.
- 3.6 In turn, as highlighted with the colours red and orange in the appended Tree Survey Schedule and in Table 2 (below), the risk assessment established that trees T5 and T6 have calculated QTRA risk indices that fall within the unacceptable risk threshold range of 1/10,000 or over (please refer to Table 1, on the previous page, with regard to advisory tree risk thresholds). Consequently, as also detailed in Table Two, recommendations are made in order to negate the risk that these trees present. In this respect it is noted that the recommended works are considered high priority and should subsequently be given immediate consideration.

Table 2: Tree Work Recommendations:

No.	Species	Management Works Recommended*	Responsible Professional	Work Priority
T1	Sycamore	1. Prune tree to remove basal growth to a height of approximately 1m and sever and remove ivy in order to allow future detailed inspections (I).	1. Tree contractor	1. Moderate
T2	Sycamore	1. Prune tree to reduce stem arising to east by approximately 2m height and width in order to subordinate and prevent increase loading on tight union at base (M).	1. Tree contractor	1. Moderate

Table Continued Overleaf

Table 2: Tree Work Recommendations: (Continued)

No.	Species	Management Works Recommended*	Responsible Professional	Work Priority
T3	Sycamore	1. Sever and remove ivy from stem in order to allow future detailed inspections (I).	1. Tree contractor	1. Moderate
T4	Ash	1. Prune tree to remove end weighted branch arising to east over overhead electric line (See TSS) (M).	1. Tree contractor	1. Moderate
T5	Downy Birch	1. Remove tree as is dead and subsequent identified increased risk of failure and unacceptable risk of harm to persons.	1. Tree contractor	1. High
T6	Ash	1. Remove tree due to identified increased risk of stem failure at base (M).	1. Tree contractor	1. High
T7	Sycamore	1. Sever and remove ivy in order to allow future detailed inspections (I).	1. Tree contractor	1. Moderate
T9	Sycamore	1. Prune to remove basal growth to approximately 1m height and sever and remove ivy in order to allow future detailed inspections (I).	1. Tree contractor	1. Moderate
G1	Birch, Oak, Sycamore	1. Sever and remove ivy from applicable trees' stems in order to allow future detailed inspections (I). 2. Prune to remove deadwood >50mm diameter directly over driveway and bridleway (M). 3. Remove Oak to west of group due evidently progressive subsidence towards low voltage overhead power line (M).	1. Tree contractor 2. Tree contractor 3. Tree contractor	1. Moderate 2. Moderate 3. Moderate
W1	Ash, Beech, Birch, Hazel, Horse Chestnut, Oak, Willow	1. Sever and remove ivy from applicable trees' stems in order to allow future detailed inspections (I).	1. Tree contractor	1. Moderate

*Note: it shall be the client's responsibility to arrange contact with the applicable local council's planning department in order to check for the presence of any statutory tree protection measures, such as the site's location within a Conservation Area and/or the presence of any Tree Preservation Orders, prior to scheduling or carrying out any tree works

3.7 Table 3, below, details the trees that are recommended for more detailed inspections for risk management related reasons following any works recommended in Table 2, along with their accompanying re-inspection schedule.

Table 3: Tree Re-Inspection Recommendations:

No.	Species	Re-Inspection Recommendations*	When?
T4	Ash	▪ Re-inspect Ash trees when in full leaf in order to apprise canopy condition in relation to colonisation by Ash Dieback Disease and make subsequent management recommendations.	Summer 2021
W1	Various broadleaf	▪ Re-inspect Ash trees when in full leaf in order to apprise canopy condition in relation to colonisation by Ash Dieback Disease and make subsequent management recommendations.	Summer 2021

*Note: Unless otherwise specified, all inspections detailed in Table 3 are to be carried out by the project tree consultant

3.8 In consideration of the moderate usage of the adjacent Saccary Lane and the proximity of the trees to various items of property, and the associated identified targets such as parked and moving vehicles and pedestrians and the overhead power lines, it is subsequently recommended that all of the trees be re-inspected on a cyclical programme of roughly every 18 months, so that they can be alternately viewed whilst both in and out of leaf in order to monitor both their structural and physiological condition and, consequently, for the site occupiers to meet their duty of care. In this respect it is therefore recommended that the trees be re-inspected during late summer 2022.

Site:	Throstle Nest, Saccary Lane, Mellor, Lancashire, BB1 9DW
Client:	Helene Andrew
Brief:	Carry out an individual tree survey of trees as identified by client on site, report on projected risk posed to persons and property, and make management recommendations where appropriate

Surveyor:	Joseph Lambert BSc(Hons) FdSc MArborA
Survey Date:	14 April 2021
Viewing Conditions:	Bright sunshine with no discernible wind
Job Reference:	BTC2187

No.	Species	Age	Height (m)	Stem Diam. (mm)	Crown Spread (m)	Vitality	Comments	Management Recommendations	Risk Assessment Description (Part/Target)	Target	Size	P.O.F	Reduced Mass %	Risk Index	Work Priority
T1	Sycamore	M	18.5	550	12	G	<ul style="list-style-type: none"> Located in narrow area between driveway to east with stone retaining wall approximately 500mm height and ditch to west, with pronounced adaptive buttressing. Slight to moderate basal growth. Very dense ivy which impeded detailed inspection of main stem above 1.5m height and primary branches. Stem bifurcates at a height of approximately 3m with a wide union 	<ul style="list-style-type: none"> Tree contractor to prune tree to remove basal growth to a height of approximately 1m and sever and remove ivy in order to allow future detailed inspections (I). 	P = Deadwood up to approximately 75mm diameter. T = Persons using adjacent driveway/bridleway.	3	4	2	25%	<1M	M
T2	Sycamore	M	21	2x470 1x370 (ms)	14	G	<ul style="list-style-type: none"> Located on very steep bank sloping east in dense area of Rhododendron, which restricted inspection. Three stems arise from ground level with tight included bark unions. Small areas of bark necrosis between stems. Stem of approximately 470mm diameter arising to east crosses and remains in contact with smaller stem between ground level and approximately 2.5m height, and has dense ivy which impeded inspection. Stem bifurcates again at approximately 4.5m height with a further tight union. 	<ul style="list-style-type: none"> Tree contractor to prune tree to reduce stem arising to east by approximately 2m height and width in order to subordinate and prevent increase loading on tight union at base (M). 	P = Stem of approximately 470mm diameter arising to east at ground level. T = Persons using adjacent driveway/bridleway.	3	1	3	N/A	40K	M
T3	Sycamore	M	13	510	10	M/G	<ul style="list-style-type: none"> Located on bank edge raised by approximately 1m from road level. Moderate ivy cover which impeded inspection. Mechanical damage of 300mm diameter on south side of stem at approximately 1m height with missing bark, likely from vehicle impact damage. Canopy suppressed by larger Ash T4 to north. Number of partially occluded pruning wounds up to approximately 120mm diameter. Small to moderate amount of deadwood up to approximately 100mm diameter. 	<ul style="list-style-type: none"> Tree contractor to sever and remove ivy from stem in order to allow future detailed inspections (I). 	P = Deadwood up to approximately 100mm diameter. T = Vehicles and occupants using Saccary Lane.	3	4	2	50%	1M	M

HEADINGS & ABBREVIATIONS

NO. TREE/GROUP REFERENCE NUMBER. REFER TO PLAN OR NUMBERED TAGS WHERE APPLICABLE
SPECIES: COMMON NAME
AGE: Y = YOUNG, SM = SEMI MATURE, EM = EARLY MATURE, M = MATURE, PM = POST MATURE
HEIGHT: APPROXIMATELY 80% OF TREES ARE MEASURED USING AN ELECTRONIC CLINOMETER AND THE REMAINDER ESTIMATED AGAINST THE MEASURED TREES
DIAMETER: STEM DIAMETER MEASURED OR ESTIMATED AT A HEIGHT OF APPROXIMATELY 1.3 METRES
CROWN SPREAD: MEASURED OR ESTIMATED DIAMETER OF CROWN(S) AT THE WIDEST POINT
VITALITY: A MEASURE OF PHYSIOLOGICAL CONDITION WHEREBY D = DEAD, MD = MORIBUND, P = POOR, M = MODERATE, G = GOOD
MANAGEMENT: SUFFIXES: (M) = FOR GENERAL ARBORICULTURAL OR SILVICULTURAL MANAGEMENT; (S) = TO REMOVE OR REDUCE THE RISK OF DIRECT DAMAGE TO A FIXED STRUCTURE BY MEANS OF CIRCUMFERENTIAL ROOT, STEM OR BRANCH GROWTH; (I) = TO ENABLE THE TREE(S) TO BE INSPECTED FURTHER FOR RISK ASSESSMENT PURPOSES
TARGET RANGE: HIGHEST VALUE TARGET THAT THE MOST SIGNIFICANT PART LIKELY TO FAIL COULD STRIKE. RANGES 1-6. 1 = HIGH, 6 = LOW VALUE/OCCUPANCY
RISK ASSESSMENT DESCRIPTION: DESCRIPTION OF PART IDENTIFIED AS MOST LIKELY TO FAIL AND ASSOCIATED TARGET, ASSESSED IN ACCORDANCE WITH QTRA SYSTEM
SIZE RANGE: SIZE CATEGORY OF MOST SIGNIFICANT PART CONSIDERED LIKELY TO FAIL. - RANGES 1-4 WHEREBY 1 = LARGE, 4 = SMALL, P = PROPERTY
P.O.F: PROBABILITY OF FAILURE WITHIN 12 MONTHS. RANGES 1-7. 1 = HIGH, 7 = LOW
REDUCED MASS %: WHERE THE MASS OF A TREE OR BRANCH IS REDUCED BY DEGRADATION THE RISK INDEX IS MULTIPLIED TO REFLECT THE PERCENTAGE OF MASS REDUCTION
RISK INDEX: E.G. RISK INDEX 20 = RISK OF SIGNIFICANT HARM 1 IN 20,000. AN ADDITIONAL FIGURE, IN BRACKETS, MAY BE SUFFIXED 'T' REPRESENTING THE RATE OF MULTIPLE OCCUPATION OVER THE YEAR, E.G. 10(10T) REPRESENTS A RISK OF HARM 1/10,000 TO 10 OCCUPANTS OR AN EQUIVALENT MONETARY VALUE. SEE QTRA PRACTICE NOTE FOR MORE INFORMATION REGARDING COLOURS USED TO SIGNIFY RISK INDEX
WORK PRIORITY: H (HIGH) = TREE WORKS TO BE GIVEN IMMEDIATE CONSIDERATION. M (MODERATE) = TREE WORKS TO BE CARRIED OUT WITHIN 12 MONTHS OF SURVEY (TIMING MAY BE SPECIFIED IN MANAGEMENT RECOMMENDATIONS). L (LOW) = TREE WORKS THAT ARE NOT CONSIDERED ESSENTIAL FOR RISK MANAGEMENT PURPOSES, BUT ARE RECOMMENDED IN ACCORDANCE WITH PRUDENT ARBORICULTURAL MANAGEMENT (TO BE REVIEWED IN 12 MONTHS, OR SPECIFIED TIME, IF APPLICABLE). N/A = NOT APPLICABLE

Site:	Throstle Nest, Saccary Lane, Mellor, Lancashire, BB1 9DW
Client:	Helene Andrew
Brief:	Carry out an individual tree survey of trees as identified by client on site, report on projected risk posed to persons and property, and make management recommendations where appropriate

Surveyor:	Joseph Lambert BSc(Hons) FdSc MArborA
Survey Date:	14 April 2021
Viewing Conditions:	Bright sunshine with no discernible wind
Job Reference:	BTC2187

No.	Species	Age	Height (m)	Stem Diam. (mm)	Crown Spread (m)	Vitality	Comments	Management Recommendations	Risk Assessment Description (Part/Target)	Target	Size	P.O.F	Reduced Mass %	Risk Index	Work Priority
T4	Common Ash	M	20	680	18	M	<ul style="list-style-type: none"> Moderate ivy cover and adjacent Holly impeded inspection. Stem bifurcates at a height of approximately 4m. Branch of approximately 350mm diameter arises horizontally at approximately 8m height over low voltage overhead electric line to east, and is largely end weighted with a significant curvature to vertical at branch end. Moderate amount of deadwood up to approximately 80mm diameter throughout. Canopy sparse and showing a moderate reduction in vitality, likely due to colonisation by Ash Dieback Disease. Number of moderately attenuated branches typical of species and age. 	<ul style="list-style-type: none"> Tree contractor to prune tree to remove end weighted branch arising to east over overhead electric line (M). NB: As failure risk is deemed tolerable it is recommended works to this tree only be carried out following implementation of below recommendation to re-inspect. Tree consultant to re-inspect during Summer 2021 (i.e. when in full leaf) in order to appraise canopy condition in relation to colonisation by Ash Dieback Disease and make subsequent recommendations. 	P = Branch of approximately 350mm diameter to east at approximately 8m height. T = Low voltage electric line below.	3	P	3	N/A	30K	M
T5	Downy Birch	PM	12	450	8	D	<ul style="list-style-type: none"> Dead tree located immediately adjacent to road. 	<ul style="list-style-type: none"> Tree contractor to remove tree as is dead and subsequent identified increased risk of failure and unacceptable risk of harm to persons. NB: Ribble Valley Borough Council notified of intention to remove on 19 April 2021. 	P = Dead stem up to approximately 350mm diameter above approximately 2m height. T = Vehicles and occupants using Saccary Lane.	3	2	1	N/A	1K	H

Site:	Throstle Nest, Saccary Lane, Mellor, Lancashire, BB1 9DW
Client:	Helene Andrew
Brief:	Carry out an individual tree survey of trees as identified by client on site, report on projected risk posed to persons and property, and make management recommendations where appropriate

Surveyor:	Joseph Lambert BSc (Hons) MArborA
Survey Date:	14 April 2021
Viewing Conditions:	Bright sunshine with no discernible wind
Job Reference:	BTC2187

No.	Species	Age	Height (m)	Stem Diam. (mm)	Crown Spread (m)	Vitality	Comments	Management Recommendations	Risk Assessment Description (Part/Target)	Target	Size	P.O.F	Reduced Mass %	Risk Index	Work Priority
T6	Common Ash	EM	14	400	8	P	<ul style="list-style-type: none"> Moderate ivy cover to stem, which partially impeded inspection. Upper canopy showing a moderate reduction in vitality, likely due to colonisation by Ash Dieback Disease. Several areas of necrotic bark around stem base with white mycelium below indicative of colonisation by basal decay fungi. Likely that reduction in vitality as a result of colonisation by Ash Dieback Disease has allowed entry to secondary pathogen. 	<ul style="list-style-type: none"> Tree contractor to remove tree due to identified increased risk of stem failure at base (M). 	P = Whole stem at ground level. T = Vehicles and occupants using Saccary Lane.	3	2	2	N/A	10K	M
T7	Sycamore	EM	14	400	8	M	<ul style="list-style-type: none"> Moderate ivy cover to stem, which partially impeded inspection. Evident moderate squirrel damage throughout upper canopy, subsequently causing partial girdling to branches up to approximately 120mm diameter. 	<ul style="list-style-type: none"> Tree contractor to sever and remove ivy in order to allow future detailed inspections (I). 	P = Part girdled branches up to approximately 120mm diameter. T = Vehicles and occupants using Saccary Lane.	3	3	3	N/A	500K	M
T8	Lawson Cypress	M	20	1x710 1x330 (ts)	8	M-G	<ul style="list-style-type: none"> Twin stemmed from ground level. Larger stem bifurcates at approximately 2m height with tight union and included bark with adaptive growth either side, typical of species. Two stems approximately 400mm diameter arise from here with several further tight unions further up stem. Accumulated leaf litter around stem base, which partially impeded inspection. 	<ul style="list-style-type: none"> Tree consultant to monitor tight unions as component of future cyclical inspections. 	P = Stem of approximately 400mm diameter at 2m height. T = Persons using driveway and bridleway.	3	2	4	N/A	1M	L
T9	Sycamore	M	17	700	10	M	<ul style="list-style-type: none"> Tree located between driveway edge, with kerbs approximately 300mm from stem base, and wooden panel fencing to south. Enlarged buttress area with moderate epicormic growth and accumulated leaf litter partly restricted detailed inspection. Accessible areas sounded with nylon mallet and gave no indications of significant hollowing. Small areas of dysfunctional bark up to approximately 200mm length and 75mm width throughout possibly from past root damage when installing kerbs to drive. Bifurcates at a height of approximately 2.5m with union obscured by lvy. Small amount of deadwood up to approximately 60mm diameter. 	<ul style="list-style-type: none"> Tree contractor to prune to remove basal growth to approximately 1m height and sever and remove lvy in order to allow future detailed inspections (I). 	P = Deadwood up to approximately 60mm diameter. T = Persons using driveway and bridleway.	3	4	2	25%	<1M	M

Site:	Throstle Nest, Saccary Lane, Mellor, Lancashire, BB1 9DW
Client:	Helene Andrew
Brief:	Carry out an individual tree survey of trees as identified by client on site, report on projected risk posed to persons and property, and make management recommendations where appropriate


Surveyor:	Joseph Lambert BSc(Hons) FdSc MArborA
Survey Date:	14 April 2021
Viewing Conditions:	Bright sunshine with no discernible wind
Job Reference:	BTC2187

No.	Species	Age	Height (m)	Stem Diam. (mm)	Crown Spread (m)	Vitality	Comments	Management Recommendations	Risk Assessment Description (Part/Target)	Target	Size	P.O.F	Reduced Mass %	Risk Index	Work Priority
T10	Western Red Cedar	M	20	800	10	G	<ul style="list-style-type: none"> Branch arises west towards drive at approximately 2m height and of approximately 420mm diameter with moderate curvature. 		<ul style="list-style-type: none"> P = Branch of approximately 420mm diameter at 2m height. T = Persons using adjacent driveway and bridleway. 	3	2	5	N/A	<1M	N/A
T11	Sycamore	M	17.5	660	11	M-G	<ul style="list-style-type: none"> Canopy showing a slight reduction in vitality. Multiple small wounds to stem up to approximately 75mm diameter, likely from past mechanical damage, between ground level and approximately 1m height. 		<ul style="list-style-type: none"> P = Deadwood up to approximately 50mm diameter. T = Persons using adjacent bridleway. 	4	4	2	25%	<1M	N/A
T12	Lawson Cypress	M	20	1000	10	G	<ul style="list-style-type: none"> Stem trifurcates just above 1.5m height with tight unions from this point, typical of species. Stems between approximately 350mm and 500mm diameter arise above this point, with further tight unions above. 	<ul style="list-style-type: none"> Tree consultant to monitor tight unions as component of future cyclical inspections. 	<ul style="list-style-type: none"> P = Stems of approximately 500mm diameter. T = Persons using adjacent driveway. 	3	1	4	N/A	400K	L
G1	Birch, Oak, Sycamore	M	≤ 22	≤ 2x500 (ts)	≤ 14	G	<ul style="list-style-type: none"> Approximately five mature Oak and four mature Sycamore, with various semi to early mature Birch and Oak dispersed within. Located on very steep bank sloping east with dense Rhododendron in parts, which restricted inspection. Many Sycamore stems bifurcate between ground level and approximately 1m height with tight unions. Oak to centre-west arises from ground level with severe lean north-west adjacent to low voltage overhead power line but over evident low use wooded area. Gap between canopy of neighbouring tree indicates progressive subsidence of stem. Many stems have moderate ivy cover which impeded inspection. Several dead branches up to approximately 150mm diameter and 7m length over bridleway and driveway to east. 	<ul style="list-style-type: none"> Tree contractor to sever and remove ivy from applicable trees' stems in order to allow future detailed inspections (I). Tree contractor to prune to remove deadwood >50mm diameter directly over driveway and bridleway (M). Tree contractor to remove Oak to west of group due evidently progressive subsidence towards low voltage overhead power line (M). 	<ul style="list-style-type: none"> P = Deadwood up to approximately 150mm diameter. T = Persons using adjacent driveway/ bridleway. 	3	3	2	N/A	50K	M

Site:	Throstle Nest, Saccary Lane, Mellor, Lancashire, BB1 9DW
Client:	Helene Andrew
Brief:	Carry out an individual tree survey of trees as identified by client on site, report on projected risk posed to persons and property, and make management recommendations where appropriate

Surveyor:	Joseph Lambert BSc (Hons) MA ArborA
Survey Date:	14 April 2021
Viewing Conditions:	Bright sunshine with no discernible wind
Job Reference:	BTC2187

No.	Species	Age	Height (m)	Stem Diam. (mm)	Crown Spread (m)	Vitality	Comments	Management Recommendations	Risk Assessment Description (Part/Target)	Target	Size	P.O.F	Reduced Mass %	Risk Index	Work Priority
W1	Ash, Beech, Birch, Hazel, Horse Chestnut, Oak, Willow	M	≤ 22	≤ 650	≤ 18	M-G	<ul style="list-style-type: none"> Edge of broadleaved wooded area adjacent to road surveyed. Approximately two mature Ash and one Sycamore are located on banking edge adjacent to road. Small to moderate amount of deadwood up to approximately 100mm diameter throughout canopies. Moderate ivy to several stems, which impeded inspection. One Beech has moderate staining to stem between ground level and approximately 1m height, indicative of colonisation by bacterial pathogen <i>Phytophthora</i> sp. 	<ul style="list-style-type: none"> Tree contractor to sever and remove ivy from applicable trees' stems in order to allow future detailed inspections (I). 	P = Deadwood up to approximately 100mm diameter. T = Vehicles and occupants using Saccary Lane.	3	4	2	50%	1M	M

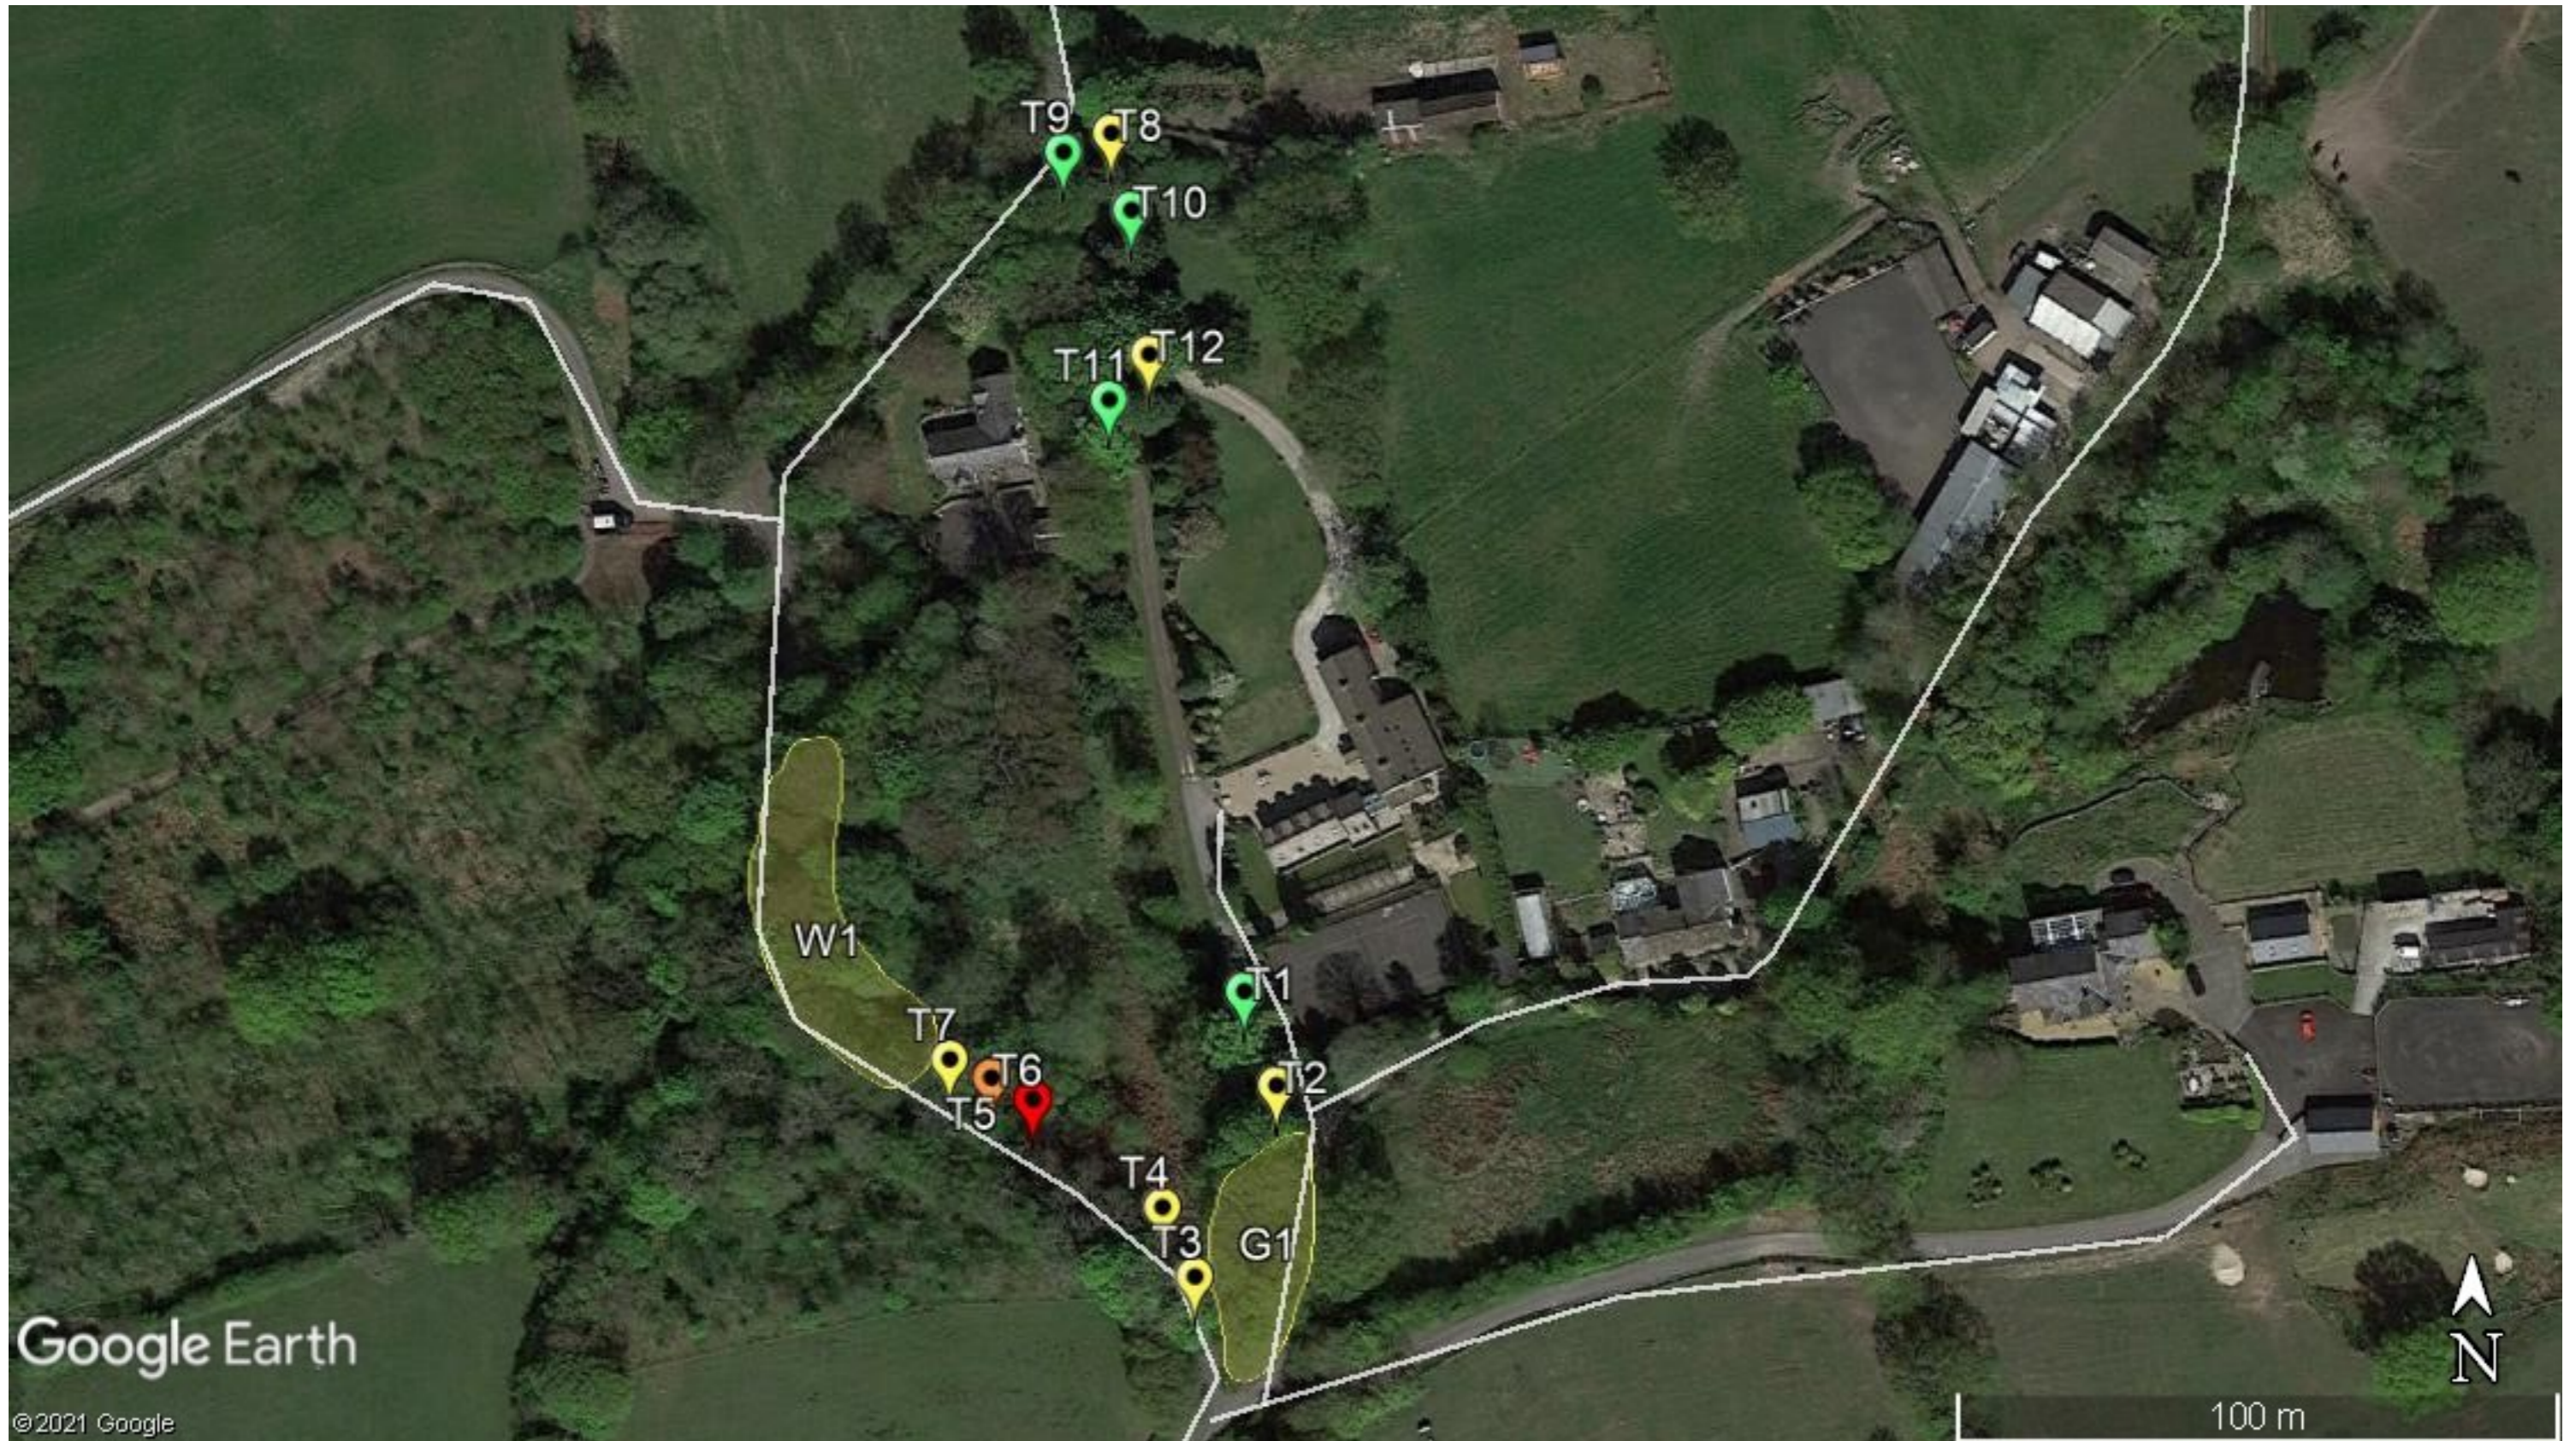

T = Individual Tree, G = Group of Trees, W = Woodland

- (Red) = Tree/Group/Woodland with Risk of Harm of 1/1,000 or greater
- (Orange) = Tree/Group/Woodland with Risk of Harm between 1/1,000 and 1/10,000
- (Yellow) = Tree/Group/Woodland with Risk of Harm between 1/10,000 and 1/1,000,000
- (Green) = Tree/Group/Woodland with Risk of Harm less than 1/1,000,000

**Site: Throstle Nest, Saccary Lane,
Mellor, Lancashire, BB1 9DW**

Job No.: BTC2187

Scale: Not to Scale

Paper Size (for printing): A3

Date: April 2021

TREE SURVEY **Bowland**

PLAN (Overview)

Tree Consultancy Ltd

*e: info@bowlandtreeconsultancy.co.uk
t: 01772 437150*

* See QTRA Methodology Overview and Application in Management Decisions Section of Report for details regarding Risk of Harm



T = Individual Tree, G = Group of Trees, W = Woodland

- (Red) = Tree/Group/Woodland with Risk of Harm of 1/1,000 or greater
- (Orange) = Tree/Group/Woodland with Risk of Harm between 1/1,000 and 1/10,000
- (Yellow) = Tree/Group/Woodland with Risk of Harm between 1/10,000 and 1/1,000,000
- (Green) = Tree/Group/Woodland with Risk of Harm less than 1/1,000,000

* See QTRA Methodology Overview and Application in Management Decisions Section of Report for details regarding Risk of Harm

**Site: Throstle Nest, Saccary Lane,
Mellor, Lancashire, BB1 9DW**

Job No.: BTC2187

Scale: Not to Scale


Paper Size (for printing): A3

Date: April 2021

TREE SURVEY **Bowland** 
PLAN
 (Plan 1 of 2)

Tree Consultancy Ltd

e: info@bowlandtreeconsultancy.co.uk
 t: 01772 437150

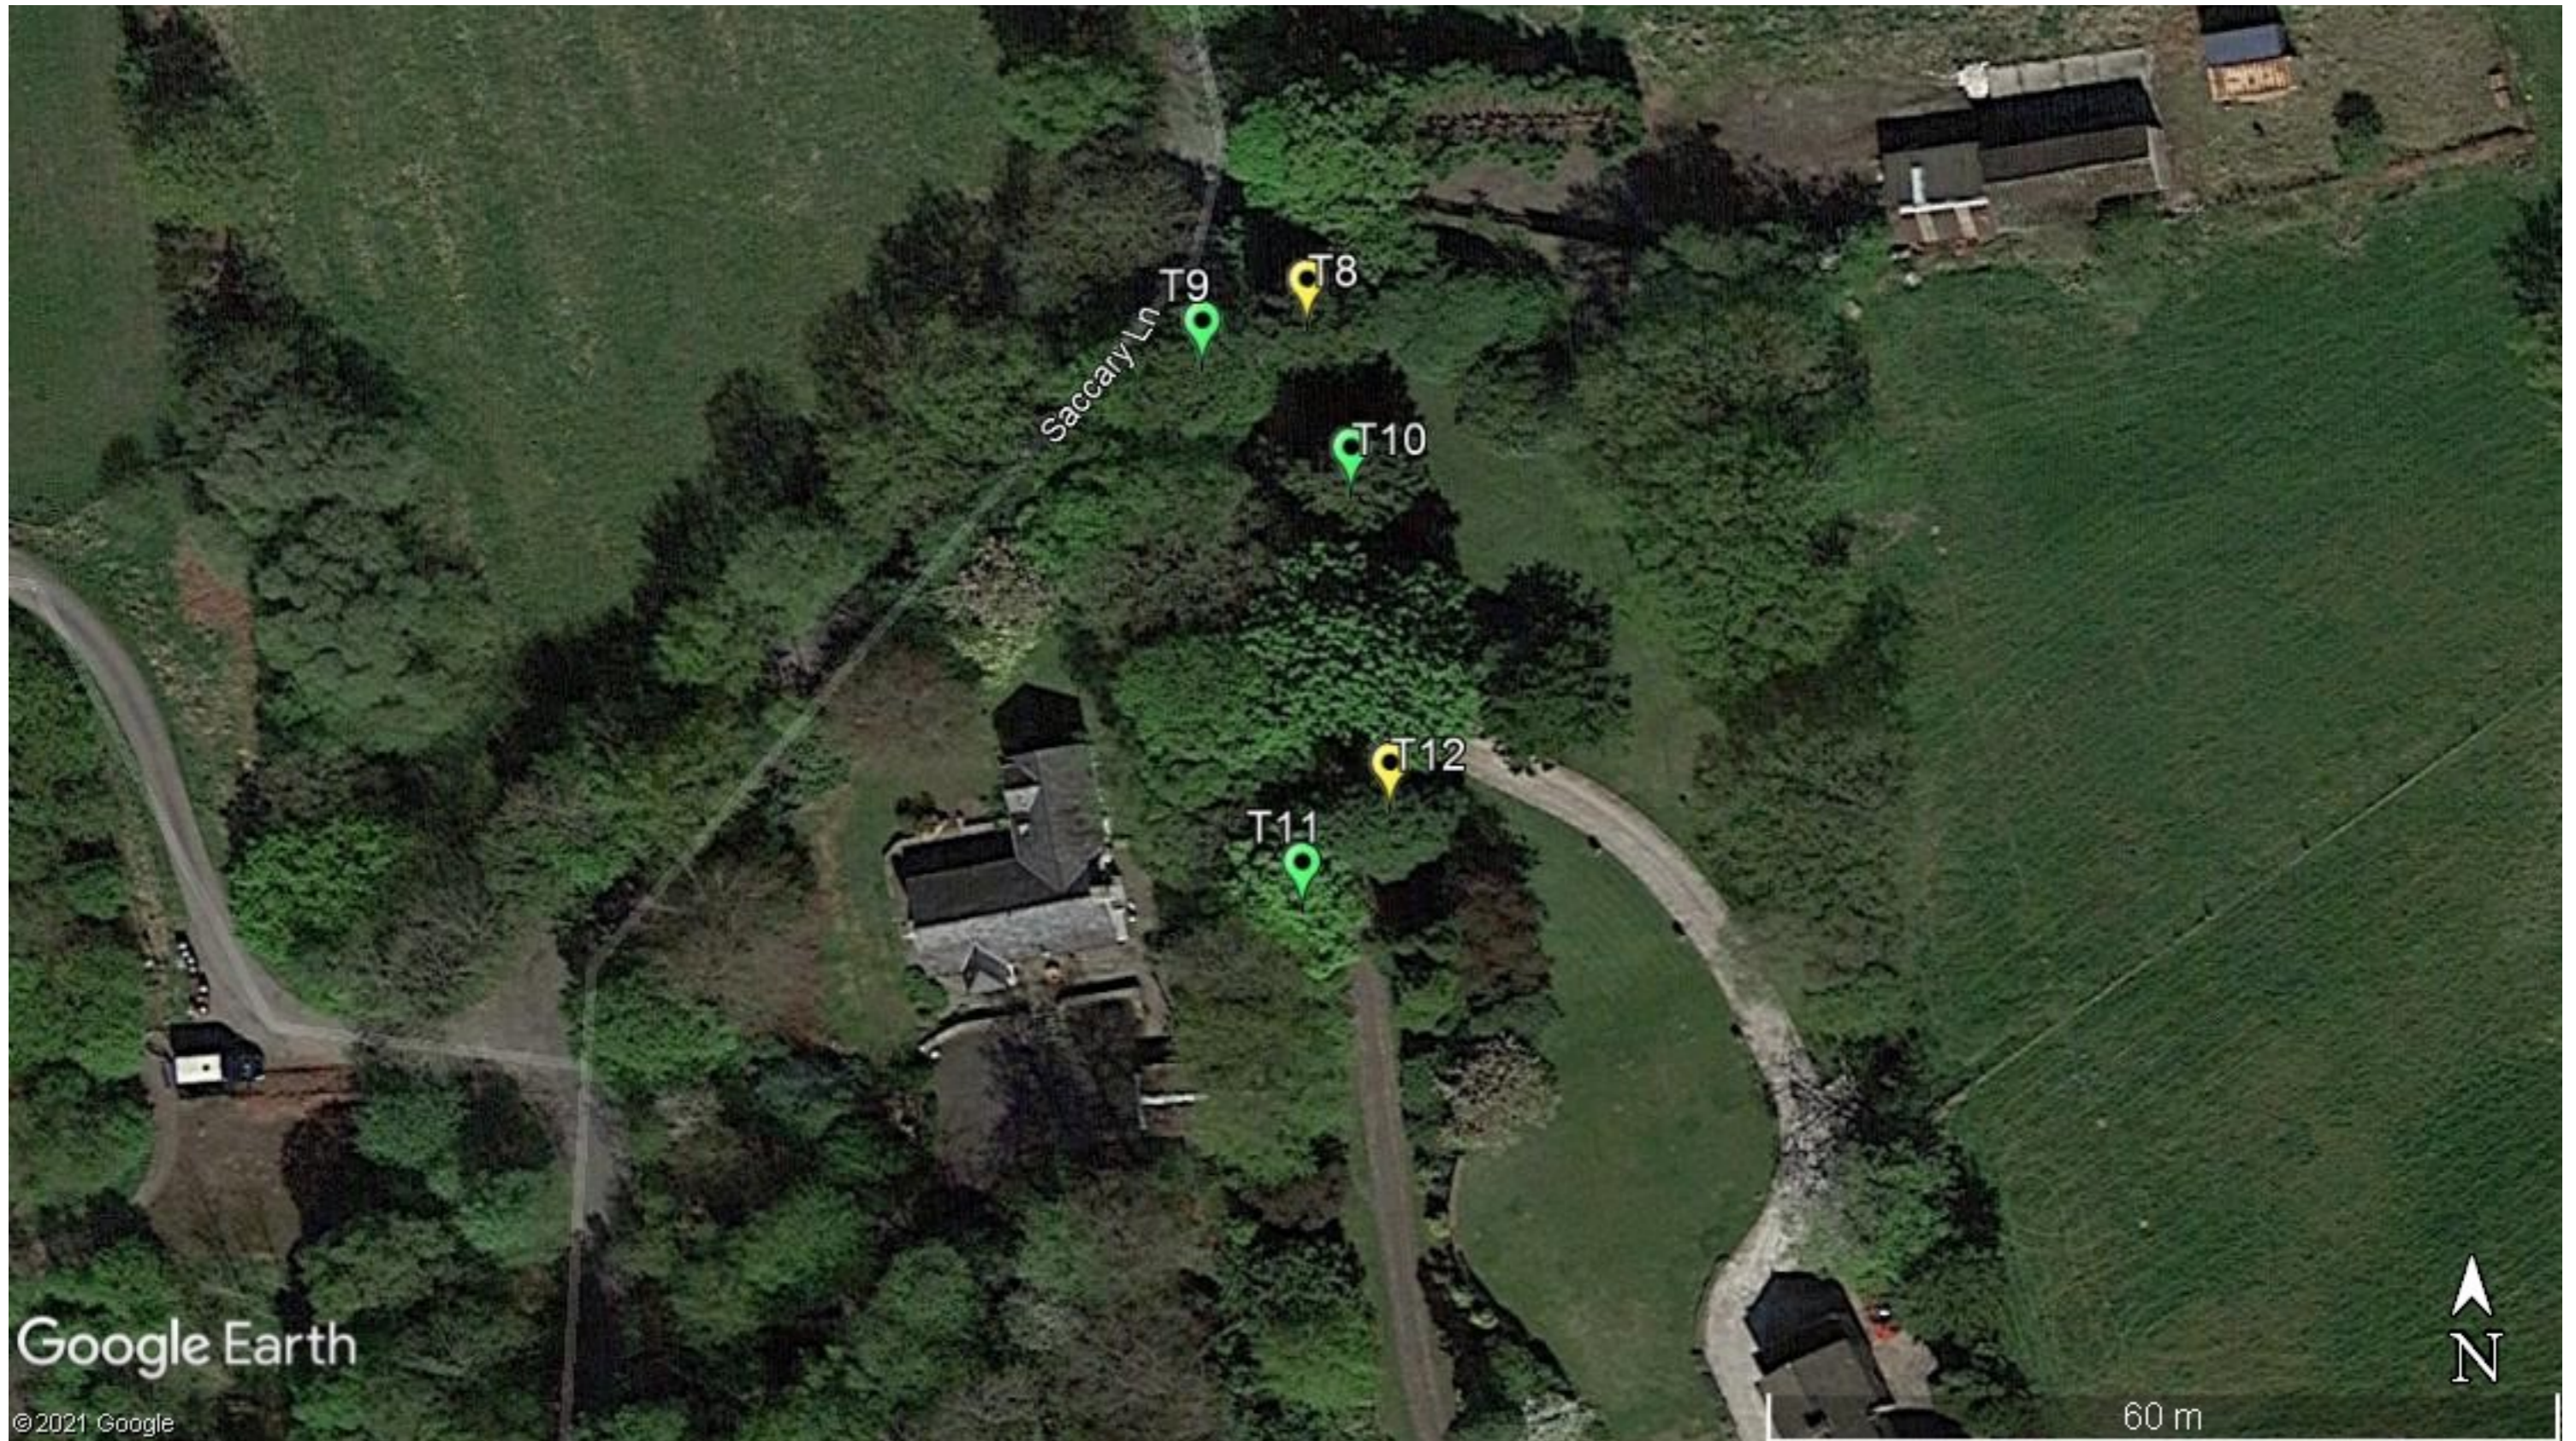

T = Individual Tree, G = Group of Trees, W = Woodland

- (Red) = Tree/Group/Woodland with Risk of Harm of 1/1,000 or greater
- (Orange) = Tree/Group/Woodland with Risk of Harm between 1/1,000 and 1/10,000
- (Yellow) = Tree/Group/Woodland with Risk of Harm between 1/10,000 and 1/1,000,000
- (Green) = Tree/Group/Woodland with Risk of Harm less than 1/1,000,000

Site: Throstle Nest, Saccary Lane, Mellor, Lancashire, BB1 9DW

Job No.: BTC2187

Scale: Not to Scale

Paper Size (for printing): A3

Date: April 2021

TREE SURVEY **Bowland** 
PLAN
 (Plan 2 of 2)

Tree Consultancy Ltd

e: info@bowlandtreeconsultancy.co.uk
 t: 01772 437150

* See QTRA Methodology Overview and Application in Management Decisions Section of Report for details regarding Risk of Harm

DISCLAIMER

Survey Limitations: Unless otherwise stated all trees are viewed from ground level using non-invasive techniques. The disclosure of hidden crown and stem defects, in particular where they may be above a reachable height or where trees are ivy clad or in areas of ground vegetation, cannot therefore be expected. All obvious defects, however, are reported. Where the QTRA Risk Index is calculated as Tolerable or Broadly Acceptable, but the tree(s) have not been adequately inspected (e.g. due to the presence of ivy and/or ground vegetation which impeded the inspection), then it is essential to follow the recommendations made in the Management Recommendations column and to have the applicable tree(s) re-inspected as recommended.

Detailed tree safety appraisals are only carried out under specific written instructions. Comments upon evident tree safety relate to the condition of said tree at the time of the survey only. The level of detail of the survey is as per the brief detailed on the Tree Survey Schedule and as per the specifics set out in the associated fee estimate for the project.

Unless otherwise stated all trees should be re-inspected annually in order to appraise their on-going mechanical integrity and physiological condition. It should, however, be recognised that tree condition is subject to change, for example due to the effects of disease, decay, high winds, development works, etc. Changes in land use or site conditions (e.g. development that increases access frequency) and the occurrence of severe weather incidents are also significant considerations with regards tree structural integrity and trees should therefore be re-assessed in the context of such changes and/or incidents and inspected at intervals relative to identified and varying site conditions and associated risks.

Where trees are located wholly or partially on neighbouring private third-party land then said land is not accessed and our inspection is therefore restricted to what can reasonably be seen from within the site. Any subsequent comments and judgments made in respect of such trees are based on these restrictions and are our preliminary opinion only. Recommendations for works to neighbouring third-party trees are only made where a potentially unacceptable risk to persons and/or property has been identified during our survey. Where significant structural defects of third-party trees are identified and associated management works are considered essential to negate any risk of harm and/or damage then we will first attempt to inform the site occupier of the issues and, if not possible, then inform the relevant Council. Where a more detailed assessment is considered necessary then appropriate recommendations are set out in the Tree Survey Schedule.

The potential influence of trees upon existing or proposed buildings or other structures, resulting from the effects of their roots abstracting water from shrinkable load-bearing soils, is not considered herein.

Copyright & Non-Disclosure Notice: The content and layout of this report are subject to copyright owned by Bowland Tree Consultancy Ltd, save to the extent that copyright has been legally assigned to us by another party or is used by Bowland Tree Consultancy Ltd under license. This report may not be copied or used without our prior written agreement for any purpose other than those indicated.

Third Parties: Any disclosure of this document to a third party is subject to this disclaimer. The report was prepared by Bowland Tree Consultancy Ltd at the instruction of and for use by our client, as named. This report does not in any way constitute advice to any third party who is able to access it by any means. Bowland Tree Consultancy Ltd excludes to the fullest extent lawfully permitted all liability whatsoever for any loss or damage arising from reliance on the contents of this report.

Statutory Tree Protection: It is the client's responsibility to check for the presence of any statutory tree protection measures, such as the site's location within a Conservation Area and/or the presence of any Tree Preservation Orders, directly with the applicable Council's planning department prior to scheduling or carrying out any tree works. In turn, it is also the client's responsibility to check for the need for a felling licence with the Forestry Commission prior to scheduling or carrying out any tree works. Bowland Tree Consultancy Ltd cannot be held responsible for any decisions made by the client to prune or remove trees where any such statutory protection exists.



Quantified Tree Risk Assessment
Simply Balancing Risks With Benefits



Quantified Tree Risk Assessment
PRACTICE NOTE

VERSION 5

Quantified Tree Risk Assessment Practice Note

"When you can measure what you are speaking about, and express it in numbers, you know something about it; but when you cannot measure it, when you cannot express it in numbers, your knowledge is of a meagre and unsatisfactory kind"

William Thomson, Lord Kelvin, Popular Lectures and Addresses [1891-1894]

1. INTRODUCTION

Every day we encounter risks in all of our activities, and the way we manage those risks is to make choices. We weigh up the costs and benefits of the risk to determine whether it is acceptable, unacceptable, or tolerable. For example, if you want to travel by car you must accept that even with all the extensive risk control measures, such as seat-belts, speed limits, airbags, and crash barriers, there is still a significant risk of death. This is an everyday risk that is taken for granted and tolerated by millions of people in return for the benefits of convenient travel. Managing trees should take a similarly balanced approach.

A risk from falling trees exists only if there is both potential for tree failure and potential for harm to result. The job of the risk assessor is to consider the likelihood and consequences of tree failure. The outcome of this assessment can then inform consideration of the risk by the tree manager, who may also be the owner.

Using a comprehensive range of values¹, Quantified Tree Risk Assessment (QTRA) enables the tree assessor to identify and analyse the risk from tree failure in three key stages. 1) to consider land-use in terms of vulnerability to impact and likelihood of occupation, 2) to consider the consequences of an impact, taking account of the size of the tree or branch concerned, and 3) to estimate the probability that the tree or branch will fail onto the land-use in question. Estimating the values of these components, the assessor can use the QTRA manual calculator or software application to calculate an annual Risk of Harm from a particular tree. To inform management decisions, the risks from different hazards can then be both ranked and compared, and considered against broadly acceptable and tolerable levels of risk.

A Proportionate Approach to Risks from Trees

The risks from falling trees are usually very low and high risks will usually be encountered only in areas

with either high levels of human occupation or with valuable property. Where levels of human occupation and value of property are sufficiently low, the assessment of trees for structural weakness will not usually be necessary. Even when land-use indicates that the assessment of trees is appropriate, it is seldom proportionate to assess and evaluate the risk for each individual tree in a population. Often, all that is required is a brief consideration of the trees to identify gross signs of structural weakness or declining health. Doing all that is reasonably practicable does not mean that all trees have to be individually examined on a regular basis (HSE 2013).

The QTRA method enables a range of approaches from the broad assessment of large collections of trees to, where necessary, the detailed assessment of an individual tree.

Risk of Harm

The QTRA output is termed the Risk of Harm and is a combined measure of the likelihood and consequences of tree failure, considered against the baseline of a lost human life within the coming year.

ALARP (As Low As Reasonably Practicable)

Determining that risks have been reduced to As Low As Reasonably Practicable (HSE 2001) involves an evaluation of both the risk and the sacrifice or cost involved in reducing that risk. If it can be demonstrated that there is gross disproportion between them, the risk being insignificant in relation to the sacrifice or cost, then to reduce the risk further is not 'reasonably practicable'.

Costs and Benefits of Risk Control

Trees confer many benefits to people and the wider environment. When managing any risk, it is essential to maintain a balance between the costs and benefits of risk reduction, which should be considered in the determination of ALARP. It is not only the financial cost of controlling the risk that should be considered, but also the loss of tree-related benefits, and the risk to workers and the public from the risk control measure itself.

¹ See Tables 1, 2 & 3.

When considering risks from falling trees, the cost of risk control will usually be too high when it is clearly ‘disproportionate’ to the reduction in risk. In the context of QTRA, the issue of ‘gross disproportion’², where decisions are heavily biased in favour of safety, is only likely to be considered where there are risks of 1/10 000 or greater.

Acceptable and Tolerable Risks

The Tolerability of Risk framework (ToR) (HSE 2001) is a widely accepted approach to reaching decisions on whether risks are broadly acceptable, unacceptable, or tolerable. Graphically represented in Figure 1, ToR can be summarised as having a Broadly Acceptable Region where the upper limit is an annual risk of death 1/1 000 000, an Unacceptable Region for which the lower limit is 1/1 000, and between these a Tolerable Region within which the tolerability of a risk will be dependent upon the costs and benefits of risk reduction. In the Tolerable Region, we must ask whether the benefits of risk control are sufficient to justify their cost.

In respect of trees, some risks cross the Broadly Acceptable 1/1 000 000 boundary, but remain tolerable. This is because any further reduction would involve a disproportionate cost in terms of the lost environmental, visual, and other benefits, in addition to the financial cost of controlling the risk.

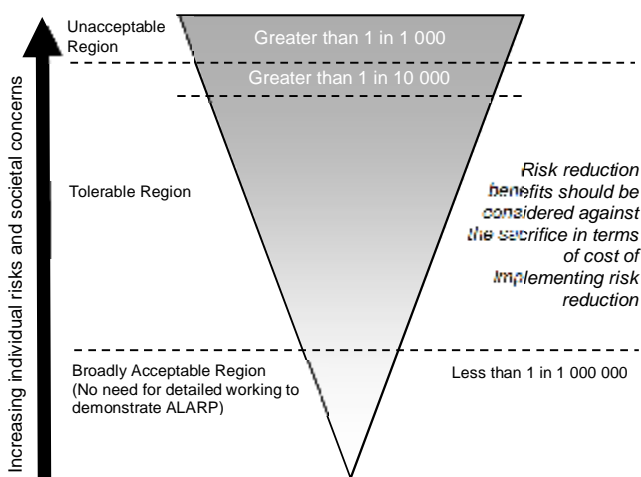


Figure 1. Adapted from the Tolerability of Risk framework (HSE 2001).

Value of Statistical Life

The Value of Statistical Life (VOSL), is a widely applied risk management device, which uses the value of a hypothetical life to guide the proportionate allocation of resources to risk reduction. In the UK,

this value is currently in the region of £2 000 000, and this is the value adopted in the QTRA method.

In QTRA, placing a statistical value on a human life has two particular uses. Firstly, QTRA uses VOSL to enable damage to property to be compared with the loss of life, allowing the comparison of risks to people and property. Secondly, the proportionate allocation of financial resources to risk reduction can be informed by VOSL. “A value of statistical life of £1 000 000 is just another way of saying that a reduction in risk of death of 1/100 000 per year has a value of £10 per year” (HSE 1996).

Internationally, there is variation in VOSL, but to provide consistency in QTRA outputs, it is suggested that VOSL of £2 000 000 should be applied internationally. This is ultimately a decision for the tree manager.

2. OWNERSHIP OF RISK

Where many people are exposed to a risk, it is shared between them. Where only one person is exposed, that individual is the recipient of all of the risk and if they have control over it, they are also the owner of the risk. An individual may choose to accept or reject any particular risk to themselves, when that risk is under their control. When risks that are imposed upon others become elevated, societal concern will usually require risk controls, which ultimately are imposed by the courts or government regulators.

Although QTRA outputs might occasionally relate to an individual recipient, this is seldom the case. More often, calculation of the Risk of Harm is based on a cumulative occupation – i.e. the number of people per hour or vehicles per day, without attempting to identify the individuals who share the risk.

Where the risk of harm relates to a specific individual or a known group of people, the risk manager might consider the views of those who are exposed to the risk when making management decisions. Where a risk is imposed on the wider community, the principles set out in the ToR framework can be used as a reasonable approach to determine whether the risk is ALARP.

3. THE QTRA METHOD - VERSION 5

The input values for the three components of the QTRA calculation are set out in broad ranges³ of Target, Size, and Probability of Failure. The assessor

² Discussed further on page 5.

³ See Tables 1, 2 & 3.

estimates values for these three components and inputs them on either the manual calculator or software application to calculate the Risk of Harm.

Assessing Land-use (Targets)

The nature of the land-use beneath or adjacent to a tree will usually inform the level and extent of risk assessment to be carried out. In the assessment of Targets, six ranges of value are available. Table 2 sets out these ranges for vehicular frequency, human occupation and the monetary value of damage to property.

Human Occupation

The probability of pedestrian occupation at a particular location is calculated on the basis that an average pedestrian will spend five seconds walking beneath an average tree. For example, ten pedestrians per day, each occupying the Target for five seconds, is a daily occupation of fifty seconds. The total seconds in a day are divided to give a probability of Target occupation ($50/86\,400 = 1/1\,728$). Where a longer occupation is likely, as with a habitable building, outdoor café, or park bench, the period of occupation can be measured, or estimated as a proportion of a given unit of time, e.g. six hours per day ($1/4$). The Target is recorded as a range (Table 2).

Weather Affected Targets

Often the nature of a structural weakness in a tree is such that the probability of failure is greatest during windy weather, while the probability of the site being occupied by people during such weather is often low. This applies particularly to outdoor recreational areas. When estimating human Targets, the risk assessor must answer the question 'in the weather conditions that I expect the likelihood of failure of the tree to be initiated, what is my estimate of human occupation?' Taking this approach, rather than using the average occupation, ensures that the assessor considers the relationship between weather, people, and trees, along with the nature of the average person with their ability to recognise and avoid unnecessary risks.

Vehicles on the Highway

In the case of vehicles, likelihood of occupation may relate to either the falling tree or branch striking the vehicle or the vehicle striking the fallen tree. Both types of impact are influenced by vehicle speed; the faster the vehicle travels the less likely it is to be struck by the falling tree, but the more likely it is to strike a fallen tree. The probability of a vehicle

occupying any particular point in the road is the ratio of the time it is occupied - including a safe stopping distance - to the total time. The average vehicle on a UK road is occupied by 1.6 people (DfT 2010). To account for the substantial protection that the average vehicle provides against most tree impacts and in particular, frontal collisions, QTRA values the substantially protected 1.6 occupants in addition to the value of the vehicle as equivalent to one exposed human life.

Property

Property can be anything that could be damaged by a falling tree, from a dwelling, to livestock, parked car, or fence. When evaluating the exposure of property to tree failure, the QTRA assessment considers the cost of repair or replacement that might result from failure of the tree. Ranges of value are presented in Table 2 and the assessor's estimate need only be sufficient to determine which of the six ranges the cost to select.

In Table 2, the ranges of property value are based on a VOSL of £2 000 000, e.g. where a building with a replacement cost of £20 000 would be valued at 0.01 ($1/100$) of a life (Target Range 2).

When assessing risks in relation to buildings, the Target to be considered might be the building, the occupants, or both. Occupants of a building could be protected from harm by the structure or substantially exposed to the impact from a falling tree if the structure is not sufficiently robust, and this will determine how the assessor categorises the Target.

Multiple Targets

A Target might be constantly occupied by more than one person and QTRA can account for this. For example, if it is projected that the average occupation will be constant by 10 people, the Risk of Harm is calculated in relation to one person constantly occupying the Target before going on to identify that the average occupation is 10 people. This is expressed as Target $1(10T)/1$, where 10T represents the Multiple Targets. In respect of property, a Risk of Harm $1(10T)/1$ would be equivalent to a risk of losing £20 000 000 as opposed to £2 000 000.

Tree or Branch Size

A small dead branch of less than 25mm diameter is not likely to cause significant harm even in the case of direct contact with a Target, while a falling branch with a diameter greater than 450mm is likely to cause some harm in the event of contact with all but the most robust Target. The QTRA method categorises

Size by the diameter of tree stems and branches (measured beyond any basal taper). An equation derived from weight measurements of trees of different stem diameters is used to produce a data set of comparative weights of trees and branches ranging from 25mm to 600mm diameter, from which Table 1 is compiled. The size of dead branches might be discounted where they have undergone a significant reduction in weight because of degradation and shedding of subordinate branches. This discounting, referred to as 'Reduced Mass',

reflects an estimated reduction in the mass of a dead branch.

Table 1. Size

Size Range	Size of tree or branch	Range of Probability
1	> 450mm (>18") dia.	1/1 - >1/2
2	260mm (10½") dia. - 450mm (18") dia.	1/2 - >1/8.6
3	110mm (4½") dia. - 250mm (10") dia.	1/8.6 - >1/82
4	25mm (1") dia. - 100mm (4") dia.	1/82 - 1/2 500

* Range 1 is based on a diameter of 600mm.

Table 2. Targets

Target Range	Property (repair or replacement cost)	Human (not in vehicles)	Vehicle Traffic (number per day)	Ranges of Value (probability of occupation or fraction of £2 000 000)
1	£2 000 000 - >£200 000	Occupation: Constant - 2.5 hours/day Pedestrians 720/hour - 73/hour & cyclists:	26 000 - 2 700 @ 110kph (68mph) 32 000 - 3 300 @ 80kph (50mph) 47 000 - 4 800 @ 50kph (32mph)	1/1 - >1/10
2	£200 000 - >£20 000	Occupation: 2.4 hours/day - 15 min/day Pedestrians 72/hour - 8/hour & cyclists:	2 600 - 270 @ 110kph (68mph) 3 200 - 330 @ 80kph (50mph) 4 700 - 480 @ 50kph (32mph)	1/10 - >1/100
3	£20 000 - >£2 000	Occupation: 14 min/day - 2 min/day Pedestrians 7/hour - 2/hour & cyclists:	260 - 27 @ 110kph (68mph) 320 - 33 @ 80kph (50mph) 470 - 48 @ 50kph (32mph)	1/100 - >1/1 000
4	£2 000 - >£200	Occupation: 1 min/day - 2 min/week Pedestrians 1/hour - 3/day & cyclists:	26 - 4 @ 110kph (68mph) 32 - 4 @ 80kph (50mph) 47 - 6 @ 50kph (32mph)	1/1 000 - >1/10 000
5	£200 - >£20	Occupation: 1 min/week - 1 min/month Pedestrians 2/day - 2/week & cyclists:	3 - 1 @ 110kph (68mph) 3 - 1 @ 80kph (50mph) 5 - 1 @ 50kph (32mph)	1/10 000 - >1/100 000
6	£20 - £2	Occupation: <1 min/month - 0.5 min/year Pedestrians 1/week - 6/year & cyclists:	None	1/100 000 - 1/1 000 000

Vehicle, pedestrian and property Targets are categorised by their frequency of use or their monetary value. The probability of a vehicle or pedestrian occupying a Target area in Target Range 4 is between the upper and lower limits of 1/1 000 and >1/10 000 (column 5). Using the VOSL £2 000 000, the property repair or replacement value for Target Range 4 is £2 000 - >200.

Probability of Failure

In the QTRA assessment, the probability of tree or branch failure within the coming year is estimated and recorded as a range of value (Ranges 1 - 7, Table 3).

Selecting a Probability of Failure (PoF) Range requires the assessor to compare their assessment of the tree or branch against a benchmark of either a non-compromised tree at Probability of Failure Range 7, or a tree or branch that we expect to fail within the year, which can be described as having a 1/1 probability of failure.

During QTRA training, Registered Users go through a number of field exercises in order to calibrate their estimates of Probability of Failure.

Table 3. Probability of Failure

Probability of Failure Range	Probability
1	1/1 - >1/10
2	1/10 - >1/100
3	1/100 - >1/1 000
4	1/1 000 - >1/10 000
5	1/10 000 - >1/100 000
6	1/100 000 - >1/1 000 000
7	1/1 000 000 - 1/10 000 000

The probability that the tree or branch will fail within the coming year.

The QTRA Calculation

The assessor selects a Range of values for each of the three input components of Target, Size and Probability of Failure. The Ranges are entered on either the manual calculator or software application to calculate a Risk of Harm.

The Risk of Harm is expressed as a probability and is rounded, to one significant figure. Any Risk of Harm that is lower than 1/1 000 000 is represented as <1/1 000 000. As a visual aid, the Risk of Harm is colour coded using the traffic light system illustrated in Table 4 (page 7).

Risk of Harm - Monte Carlo Simulations

The Risk of Harm for all combinations of Target, Size and Probability of Failure Ranges has been calculated using Monte Carlo simulations⁴. The QTRA Risk of Harm is the mean value from each set of Monte Carlo results.

In QTRA Version 5, the Risk of Harm should not be calculated without the manual calculator or software application.

Assessing Groups and Populations of Trees

When assessing populations or groups of trees, the highest risk in the group is quantified and if that risk is tolerable, it follows that risks from the remaining trees will also be tolerable, and further calculations are unnecessary. Where the risk is intolerable, the next highest risk will be quantified, and so on until a tolerable risk is established. This process requires prior knowledge of the tree manager's risk tolerance.

Accuracy of Outputs

The purpose of QTRA is not necessarily to provide high degrees of accuracy, but to provide for the quantification of risks from falling trees in a way that risks are categorised within broad ranges (Table 4).

4. INFORMING MANAGEMENT DECISIONS

Balancing Costs and Benefits of Risk Control

When controlling risks from falling trees, the benefit of reduced risk is obvious, but the costs of risk control are all too often neglected. For every risk reduced there will be costs, and the most obvious of these is the financial cost of implementing the control measure. Frequently overlooked is the transfer of risks to workers and the public who might be directly affected by the removal or pruning of trees. Perhaps

more importantly, most trees confer benefits, the loss of which should be considered as a cost when balancing the costs and benefits of risk control.

When balancing risk management decisions using QTRA, consideration of the benefits from trees will usually be of a very general nature and not require detailed consideration. The tree manager can consider, in simple terms, whether the overall cost of risk control is a proportionate one. Where risks are approaching 1/10 000, this may be a straightforward balancing of cost and benefits. Where risks are 1/10 000 or greater, it will usually be appropriate to implement risk controls unless the costs are grossly disproportionate to the benefits rather than simply disproportionate. In other words, the balance being weighted more on the side of risk control with higher associated costs.

Considering the Value of Trees

It is necessary to consider the benefits provided by trees, but they cannot easily be monetised and it is often difficult to place a value on those attributes such as habitat, shading and visual amenity that might be lost to risk control.

A simple approach to considering the value of a tree asset is suggested here, using the concept of 'average benefits'. When considered against other similar trees, a tree providing 'average benefits' will usually present a range of benefits that are typical for the species, age and situation. Viewed in this way, a tree providing 'average benefits' might appear to be low when compared with particularly important trees – such as in Figure 2, but should nonetheless be sufficient to offset a Risk of Harm of less than 1/10 000. Without having to consider the benefits of risk controls, we might reasonably assume that below 1/10 000, the risk from a tree that provides 'average benefits' is ALARP.

In contrast, if it can be said that the tree provides lower than average benefits because, for example, it is declining and in poor physiological condition, it may be necessary to consider two further elements. Firstly, is the Risk of Harm in the upper part of the Tolerable Region, and secondly, is the Risk of Harm likely to increase before the next review because of an increased Probability of Failure. If both these conditions apply then it might be appropriate to consider the balance of costs and benefits of risk reduction in order to determine whether the risk is ALARP. This balance requires the tree manager to take a view of both the reduction in risk and the costs of that reduction.

⁴ For further information on the Monte Carlo simulation method, refer to http://en.wikipedia.org/wiki/Monte_Carlo_method



Fig. 2

Lower Than Average Benefits from Trees

Usually, the benefits provided by a tree will only be significantly reduced below the 'average benefits' that are typical for the species, age and situation, if the life of the benefits is likely to be shortened, perhaps because the tree is declining or dead. That is not to say that a disbenefit, such as undesirable shading, lifting of a footpath, or restricting the growth of other trees, should not also be considered in the balance of costs and benefits.

The horse chestnut tree in Figure 3 has recently died, and over the next few years, may provide valuable habitats. However, for this tree species and the relatively fast rate at which its wood decays, the lifetime of these benefits is likely to be limited to only a few years. This tree has an already reduced value that will continue to reduce rapidly over the coming five to ten years at the same time as the Risk of Harm is expected to increase. There will be changes in the benefits provided by the tree as it degrades. Visual qualities are likely to reduce while the decaying wood provides habitats for a range of species, for a short while at least. There are no hard and fast measures of these benefits and it is for the tree manager to decide what is locally important and how it might be balanced with the risks.

Where a risk is within the Tolerable Region and the tree confers lower than average benefits, it might be appropriate to consider implementing risk control while taking account of the financial cost. Here, VOSL can be used to inform a decision on whether the cost of risk control is proportionate. Example 3 below puts this evaluation into a tree management context.

There will be occasions when a tree is of such minimal value and the monetary cost of risk reduction so low that it might be reasonable to

further reduce an already relatively low risk. Conversely, a tree might be of such considerable value that an annual risk of death greater than 1/10 000 would be deemed tolerable.

Occasionally, decisions will be made to retain elevated risks because the benefits from the tree are particularly high or important to stakeholders, and in these situations, it might be appropriate to assess and document the benefits in some detail. If detailed assessment of benefits is required, there are several methodologies and sources of information (Forest Research 2010).



Fig. 3

Delegating Risk Management Decisions

Understanding of the costs with which risk reduction is balanced can be informed by the risk assessor's knowledge, experience and on-site observations, but the risk management decisions should be made by the tree manager. That is not to say that the tree manager should review and agree every risk control measure, but when delegating decisions to surveyors and other staff or advisors, tree managers should set out in a policy, statement or contract, the principles and perhaps thresholds to which trees and their associated risks will ordinarily be managed.

Based on the tree manager accepting the principles set out in the QTRA Practice Note and or any other specific instructions, the risk assessor can take account of the cost/benefit balance and for most

situations will be able to determine whether the risk is ALARP when providing management recommendations.

Table 4. QTRA Advisory Risk Thresholds

Thresholds	Description	Action
1/1,000	Unacceptable Risks will not ordinarily be tolerated	<ul style="list-style-type: none"> Control the risk
	Unacceptable (where imposed on others) Risks will not ordinarily be tolerated	<ul style="list-style-type: none"> Control the risk Review the risk
1/10 000	Tolerable (by agreement) Risks may be tolerated if those exposed to the risk accept it, or the tree has exceptional value	<ul style="list-style-type: none"> Control the risk unless there is broad stakeholder agreement to tolerate it, or the tree has exceptional value Review the risk
	Tolerable (where imposed on others) Risks are tolerable if ALARP	<ul style="list-style-type: none"> Assess costs and benefits of risk control Control the risk only where a significant benefit might be achieved at reasonable cost Review the risk
1/1 000 000	Broadly Acceptable Risk is already ALARP	<ul style="list-style-type: none"> No action currently required Review the risk

QTRA Informative Risk Thresholds

The QTRA advisory thresholds in Table 4 are proposed as a reasonable approach to balancing safety from falling trees with the costs of risk reduction. This approach takes account of the widely applied principles of ALARP and ToR, but does not dictate how these principles should be applied. While the thresholds can be the foundation of a robust policy for tree risk management, tree managers should make decisions based on their own situation, values and resources. Importantly, to enable tree assessors to provide appropriate management guidance, it is helpful for them to have some understanding of the tree owner's management preferences prior to assessing the trees.

A Risk of Harm that is less than 1/1 000 000 is Broadly Acceptable and is already ALARP. A Risk of Harm 1/1 000 or greater is unacceptable and will not ordinarily be tolerated. Between these two values, the Risk of Harm is in the Tolerable Region of ToR and will be tolerable if it is ALARP. In the Tolerable

Region, management decisions are informed by consideration of the costs and benefits of risk control, including the nature and extent of those benefits provided by trees, which would be lost to risk control measures.

For the purpose of managing risks from falling trees, the Tolerable Region can be further broken down into two sections. From 1/1 000 000 to less than 1/10 000, the Risk of Harm will usually be tolerable providing that the tree confers 'average benefits' as discussed above. As the Risk of Harm approaches 1/10 000 it will be necessary for the tree manager to consider in more detail the benefits provided by the tree and the overall cost of mitigating the risk.

A Risk of Harm in the Tolerable Region but 1/10 000 or greater will not usually be tolerable where it is imposed on others, such as the public, and if retained, will require a more detailed consideration of ALARP. In exceptional circumstances a tree owner might choose to retain a Risk of Harm that is 1/10 000 or greater. Such a decision might be based on the agreement of those who are exposed to the risk, or perhaps that the tree is of great importance. In these circumstances, the prudent tree manager will consult with the appropriate stakeholders whenever possible.

5. EXAMPLE QTRA CALCULATIONS AND RISK MANAGEMENT DECISIONS

Below are three examples of QTRA calculations and application of the QTRA Advisory Thresholds.

Example 1.

	Target	Size	Probability of Failure	Risk of Harm
Range	6	x 1	x 3	= <1/1 000 000

Example 1 is the assessment of a large (Size 1), unstable tree with a probability of failure of between 1/100 and >1/1 000 (PoF 3). The Target is a footpath with less than one pedestrian passing the tree each week (Target 6). The Risk of Harm is calculated as less than 1/1 000 000 (green). This is an example of where the Target is so low consideration of the structural condition of even a large tree would not usually be necessary.

Example 2.

	Target		Size		Probability of Failure		Risk of Harm
Range	1	x	4	x	3	=	1(2T)/50 000

In Example 2, a recently dead branch (Size 4) overhangs a busy urban high street that is on average occupied constantly by two people, and here Multiple Target occupation is considered.

Having an average occupancy of two people, the Risk of Harm 1(2T)/50 000 (yellow) represents a twofold increase in the magnitude of the consequence and is therefore equivalent to a Risk of Harm 1/20 000 (yellow). This risk does not exceed 1/10 000, but being a dead branch at the upper end of the Tolerable Region it is appropriate to consider the balance of costs and benefits of risk control. Dead branches can be expected to degrade over time with the probability of failure increasing as a result. Because it is dead, some of the usual benefits from the branch have been lost and it will be appropriate to consider whether the financial cost of risk control would be proportionate.

Example 3.

	Target		Size		Probability of Failure		Risk of Harm
Range	3	x	3	x	3	=	1/500 000

In Example 3, a 200mm diameter defective branch overhangs a country road along which travel between 470 and 48 vehicles each day at an average speed of 50kph (32mph) (Target Range 3). The branch is split and is assessed as having a probability of failure for the coming year of between 1/100 and 1/1 000 (PoF Range 3). The Risk of Harm is calculated as 1/500 000 (yellow) and it needs to be considered whether the risk is ALARP. The cost of removing the branch and reducing the risk to Broadly Acceptable (1/1 000 000) is estimated at £350. To establish whether this is a proportionate cost of risk control, the following equation is applied. £2 000 000 (VOSL) x 1/500 000 = £4 indicating that the projected cost of £350 would be disproportionate to the benefit. Taking account of the financial cost, risk transfer to arborists and passers-by, the cost could be described as being grossly disproportionate, even if accrued benefits over say ten years were taken into account.

References

- DfT. 2000. Highway Economic Note N. 1. '*Valuation of Benefits of Prevention of Road Accidents and Casualties*'. Department for Transport.
- DfT. 2010. Department for Transport. *Vehicles Factsheet*. Department for Transport, London. pp. 4. Available for download at <http://www.dft.gov.uk/statistics>
- Forest Research. 2010. *Benefits of green infrastructure* - Report by Forest Research. Forest Research, Farnham, Surrey. 42 pp.
- HSE. 1996. *Use of Risk Assessment Within Government Departments*. Report prepared by the Interdepartmental Liaison Group on Risk Assessment. Health and Safety Executive. HSE Books, Sudbury, Suffolk. 48 pp.
- HSE. 2001. *Reducing Risks: Protecting People*. Health and Safety Executive, [online]. Available for download at <http://www.hse.gov.uk/risk/theory/r2p2.pdf> (accessed 05/11/2013).
- HSE. 2013. *Sector Information Minute - Management of the risk from falling trees or branches*. Health & Safety Executive, Bootle, [online]. Available for download at http://www.hse.gov.uk/foi/internalops/sims/ag_food/010705.htm (accessed 05/11/2013).
- ISO. 2009. ISO Guide 73. *Risk Management Vocabulary*. International Organization for Standardization. Geneva. 17 pp.
- Tritton, L. M. and Hornbeck, J. W. 1982. *Biomass Equations for Major Tree Species*. General Technical Report NE69. United States Department of Agriculture.
- Revision 5.1.5. Monetary values for non-uk versions updated at 1st January 2016.
- © 2016. Published by Quantified Tree Risk Assessment Limited. 9 Lowe Street, Macclesfield, Cheshire, SK11 7NJ, United Kingdom.