# Arboricultural Constraints Appraisal

in Respect of Proposed Residential Development at



# Land off Chatburn Old Road, Chatburn, Lancashire, BB7 4EP

Prepared by: Bowland C Tree Consultancy Ltd

March 2022

## **CONTENTS**

- 1. TREE SURVEY SCHEDULE & BS5837: 2012 TABLE 1
- 2. TEMPORARY PROTECTIVE FENCING SPECIFICATION
- 3. TREE CONSTRAINTS PLAN

Contact Details

Bowland Tree Consultancy Ltd Unit Two First Floor 11 Cannon Street Preston Lancashire PR1 3NR

T: 01772 437150 E: info@bowlandtreeconsultancy.co.uk



# PROJECT DETAILS

Project No.:	BTC2414
Site:	Land off Chatburn Old Road, Chatburn, BB7 4EP
Client:	JJ Construction (NW) Ltd
Council:	Ribble Valley Borough Council
Survey Date:	23 March 2022
Surveyed by:	Phill Harris MSc BSc(Hons) HND MArborA CEnv MICFor
Prepared by:	Phill Harris MSc BSc(Hons) HND MArborA CEnv MICFor
Checked by:	
Date of Issue:	29 March 2022
Version No:	1





#### DISCLAIMER

Survey Limitations: Unless otherwise stated all trees are surveyed from ground level using non-invasive techniques. The disclosure of hidden crown and stem defects, in particular where they may be above a reachable height or where trees are ivy clad or in areas of ground vegetation, cannot therefore be expected. All obvious defects, however, are reported. Detailed tree safety appraisals are only carried out under specific written instructions. Comments upon evident tree safety relate to the condition of said tree at the time of the survey only.

Unless otherwise stated all trees should be re-inspected annually in order to appraise their on-going mechanical integrity and physiological condition. It should, however, be recognised that tree condition is subject to change, for example due to the effects of disease, decay, high winds, development works, etc. Changes in land use or site conditions (e.g. development that increases access frequency) and the occurrence of severe weather incidents are also significant considerations with regards tree structural integrity and trees should therefore be re-assessed in the context of such changes and/or incidents and inspected at intervals relative to identified and varying site conditions and associated risks.

Where trees are located wholly or partially on neighbouring private third-party land then said land is not accessed and our inspection is therefore restricted to what can reasonably be seen from within the site. Stem diameters of trees located on such land are estimated. Any subsequent comments and judgments made in respect of such trees are based on these restrictions and are our preliminary opinion only. Recommendations for works to neighbouring third-party trees are only made where a potentially unacceptable risk to persons and/or property has been identified during our survey. Where significant structural defects of third-party trees are identified and associated management works are considered essential to negate any risk of harm and/or damage then we will first attempt to inform the site occupier of the issues and, if not possible, then inform the relevant Council. Where a more detailed assessment is considered necessary then appropriate recommendations are set out in the Tree Survey Schedule.

Where tree stem locations are not included on the plan(s) provided then they are plotted at the time of the survey using, where appropriate and/or practicable, a combination of measurement triangulation and GPS co-ordination. Where this is not possible then locations are estimated. Restrictions in these respects are detailed in the report.

The tree survey and any report information provided is intended as a guide to identify key tree related constraints to site development only. As such, the potential influence of trees upon existing or proposed buildings or other structures resulting from the effects of their roots abstracting water from shrinkable load-bearing soils is not considered herein. The tree survey information in its current form should not therefore be considered sufficient to determine appropriate foundation depths for new buildings. Accordingly, an updated survey, with reference to the current NHBC Standards Chapter 4.2 - Building Near Trees, must therefore be prepared for the specific purpose of informing suitable foundation depths subsequent to planning approval being granted. The advice of a structural engineer must also be sought with regard to appropriate foundation depths for new buildings.

**Copyright & Non-Disclosure Notice:** The content and layout of this report are subject to copyright owned by Bowland Tree Consultancy Ltd, save to the extent that copyright has been legally assigned to us by another party or is used by Bowland Tree Consultancy Ltd under license. This report may not be copied or used without our prior written agreement for any purpose other than those indicated.

Third Parties: Any disclosure of this document to a third party is subject to this disclaimer. The report was prepared by Bowland Tree Consultancy Ltd at the instruction of and for use by our client, as named. This report does not in any way constitute advice to any third party who is able to access it by any means. Bowland Tree Consultancy Ltd excludes to the fullest extent lawfully permitted all liability whatsoever for any loss or damage arising from reliance on the contents of this report.

**Statutory Tree Protection:** It is the client's responsibility to check for the presence of any statutory tree protection measures, such as the site's location within a Conservation Area and/or the presence of any Tree Preservation Orders, directly with the applicable Council's planning department prior to scheduling or carrying out any tree works. In turn, it is also the client's responsibility to check for the need for a felling licence with the Forestry Commission prior to scheduling or carrying out any tree works. Bowland Tree Consultancy Ltd cannot be held responsible for any decisions made by the client to prune or remove trees where any such statutory protection exists.

	TREE SU	RVEY SCHEDULE FOR ARBORICULTURAL CONSTRAINTS APPRAISAL	Surveyor:	Phill Harris Chartered Arboriculturist	Γ	
Client: JJ Construction (NW) Ltd	Site:	Land off Chatburn Old Road, Chatburn, Lancashire, BB7 4EP	Survey Date:	23 March 2022		Page: 1 of 2
	Client:	JJ Construction (NW) Ltd	Job Reference:	BTC2414		_

No.	Species	Height	Stem Diam.	Branch Spread	Branch & Canopy Clearances	Life Stage	PC	General Observations and Comments	Management Recommendations	ERC	Cat. Grade	RPA (m²)	RPA Radius (m)
T1	Common Beech	18.5	1100	N 8.5 E 6 S 8.5 W 8.5	3 1.5	PM	М	<ul> <li>Severe bulbosity to stem base.</li> <li>Substantial number of partially occluded wounds to lower stem.</li> <li>Crown showing signs of a moderate reduction in vitality.</li> </ul>		20+	B1/2	547	13.2
T2	Common Lime	20	700	N 6 E 6 S 6 W 1	3 0.5	М	G	<ul> <li>Very dense adventitious growth to lower stem, which substantially impeded visual inspection.</li> <li>Highly biased crown east due to partial suppression by neighbouring tree T1.</li> </ul>	•	20+	B1/2	222	8.4
Т3	Common Ash	10	050	N 2.5 E 2.5 S 2.5 W 2.5	4 3	SM	М	Growing from small rocky area with exposed structural roots.	•	<10	U	28	3
Т4	Sycamore	20	700#	N 6 E 8 S 10 W 10	5-W 5	Μ	М	<ul> <li>Located on neighbouring land and subsequently not inspected in detail.</li> <li>Crown showing signs of a reduction in vitality.</li> </ul>	•	40+	A1	222	8.4
Т5	Sycamore	12	1x200 2x150 (ms)#	N 3.5 E 3.5 S 3.5 W 3.5	3 1.5	SM	G	<ul> <li>Located on neighbouring land and subsequently not inspected in detail.</li> <li>Stem trifurcates at a height of approximately 0.5m with tight forks and included bark.</li> </ul>	•	10+	C1	38	3.5
Т6	Common Beech	8	250#	N 4.5 E 4.5 S 4.5 W 4.5	N/A 1.5	SM	G	<ul> <li>Located on neighbouring land and subsequently not inspected in detail.</li> </ul>		40+	B1	55	4.2

Headings and Abbreviations:

riedulings and Appleviations.							
No.	Allocated sequential reference number - Tree ('T'), Group ('G'), Woodland ('W') or Hedge ('H') reference number - refer to plan and to numbered tags where applicable						
Species:	Common name						
Height:	In metres, to half nearest metre – where possible approximately 80% are measured using an electronic clinometer and the remainder estimated against the measured trees. In the case of Groups and Woodlands the measurement listed is that of the highest tree						
Stem Diam.:	Stem diameter in millimetres, to nearest 10mm - measured and calculated as per Annex C of BS5837:2012. MS = multi-stemmed, TS = twin-stemmed						
Branch Spread:	Crown radius measured (or estimated where considered appropriate) from the four cardinal points (north, east, south and west) to give an accurate visual representation of the crown						
Branch & Canopy Clearances:	Existing height above ground level, in metres, of first significant branch and direction of growth (e.g. 2.5-N) and of canopy at lowest point – to inform on crown to height ratio, potential for shading, etc.						
Life Stage:	Estimated age class - Y = young, SM = semi-mature, EM = early-mature, M = mature, PM = post-mature						
PC:	Physiological Condition - a measure of the tree'(s)' overall vitality, i.e. D = Dead, MD = Moribund, P = Poor, M = Moderate, G = Good						
General Observations and Comments:	Comments relating to the tree'(s)' overall condition and any other pertinent factors including structural defects, current and potential direct structural damage, physiological decline, poor form, etc.						
Management Recommendations:	Either Preliminary or In Consideration of the Proposal - In the case of Arboricultural Constraints Surveys the recommended management works only take exiting site and tree circumstances and conditions into account and not proposed developments. Arboricultural Impact Assessment and Method Statement related						
	Surveys take the proposed development into consideration with recommendations made accordingly. More than one option may be given if considered appropriate						
ERC:	Estimated Remaining Contribution - in years as per BS5837:2012 (i.e. <10, 10+, 20+, 40+)						
Cat. Grade:	Category Grading - tree retention value listed as U, A, B or C - in accordance with BS5837:2012 Table 1						
RPA m²:	Root Protection Area in m <sup>2</sup> - calculated area around the tree that must be appropriately protected throughout the development process in order avoid root damage	Bowland Ć					
RPA Radius (m):	Root Protection Area Radius - in metres measured from the centre of the stem to the line of tree protection						
# (Estimated Dimensions):	Where trees are located off-site, or are inaccessible for any other reason, and accurate measurements or other information cannot be taken then the information provided is estimated and is duly suffixed with a "#" symbol	Tree Consultancy Ltd					

# TREE SURVEY SCHEDULE FOR ARBORICULTURAL CONSTRAINTS APPRAISAL Surveyor: Phill Harris Chartered Arboriculturist Site: Land off Chatburn Old Road, Chatburn, Lancashire, BB7 4EP Survey Date: 23 March 2022 Page: 2 of 2 Client: JJ Construction (NW) Ltd BTC2414 Page: 2 of 2

No.	Species	Height	Stem Diam.		Branch Spread	Branch & Canopy Clearances	Life Stage	PC	General Observations and Comments	Management Recommendations	ERC	Cat. Grade	RPA (m²)	RPA Radius (m)
G1	approx. 5no. Common Ash	≤ 20	≤ 600#	E S	≤ 6 ≤ 10 ≤ 5 ≤ 8	N/A ≥ 1.5	SM- EM		<ul> <li>Located on neighbouring land and subsequently not inspected in detail.</li> <li>Moderately to closely spaced group along boundary wall.</li> <li>Dense ivy up stems.</li> <li>Central tree has substantial whole stem failure at ground level and is now laying on wall and on ground within site.</li> <li>All have poor form.</li> <li>All have symptoms of colonisation by Ash Dieback Disease, with several evidently in advanced states of decline.</li> <li>*Note: Development of site anticipated to significantly increase usage of areas within falling distances of trees, whereby their predicted eventual death from ADD and subsequent failure is projected to present an unacceptable risk of damage to property and/or harm to persons if they are retained.</li> </ul>	<ul> <li>Client to inform landowner upon which trees stand of their poor physiological condition and associated short projected remaining safe life expectancies, with resultant requirement for their removal (see *note in Comments).</li> </ul>	<10	U	≤ 163	≤ 7.2
G2	Leyland Cypress	≤ 5	≤ 190#	E S	≤ 3.5 ≤ 3 ≤ 3 ≤ 4	N/A ≥ 1	Y	G	<ul> <li>Located on neighbouring land and subsequently not inspected in detail.</li> <li>Very closely spaced linear group planted in extremely small space between shed and fence, with subsequent limited potential for future growth and high resultant potential to cause displacement to both items of property.</li> </ul>		10+	C1	≤ 16	≤ 2.28
G3	Common Hawthorn	≤ 6	≤ 4x90 (ms)	E S	≤ 2.5 ≤ 2.5 ≤ 2.5 ≤ 2.5	N/A ≥ 0	SM	G	<ul> <li>Closely to loosely spaced group growing in and around ground basin.</li> <li>All are multi stemmed.</li> </ul>		40+	C1	≤ 15	≤ 2.16
W1	Common Ash	≤ 19.5	≤ 600#	E S	≤ 7.5 ≤ 7.5 ≤ 7.5 ≤ 7.5	N/A ≥ 5	EM	D-P	<ul> <li>Woodland located on neighbouring land and subsequently not inspected in detail.</li> <li>Areas closest to site boundaries mainly made up of Ash.</li> <li>All Ash trees close to boundary wall showing variable symptoms of colonisation by ADD, with some in advanced states of decline and others in early to mid states of colonisation and decline.</li> <li>*Note: Development of site anticipated to significantly increase usage of areas within falling distances of trees, whereby their predicted eventual death from ADD and subsequent failure is projected to present an unacceptable risk of damage to property and/or harm to persons if they are retained.</li> </ul>	<ul> <li>Client to inform landowner upon which trees stand of their poor physiological condition and associated short projected remaining safe life expectancies, with resultant requirement for their removal (see *note in Comments).</li> </ul>	<10	U	≤ 163	≤ 7.2

Category and definition	Criteria (including subcategories where app	ropriate)		Identification on plan
Trees unsuitable for retention (see				
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	<ul> <li>that will become unviable after removal of cannot be mitigated by pruning)</li> <li>Trees that are dead or are showing signs of Trees infected with pathogens of significar suppressing adjacent trees of better qualities</li> </ul>	tructural defect, such that their early loss is expected other category U trees (e.g. where, for whatever re- of significant, immediate, and irreversible overall de- nce to the health and/or safety of other trees nearby y tential conservation value which it might be desirated	ecline , or very low quality trees	Red
	1. Mainly arboricultural qualities	2. Mainly landscape qualities	3. Mainly cultural values, including conservation	
Trees to be considered for retention	on			
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	Green
Category B Those of moderate quality and value: those in such a condition as to make a significant contribution. A minimum of 20 years is suggested.	Trees that might be included in the high category, but are downgraded because of impaired condition. Examples include the presence of remediable defects including unsympathetic past management and minor storm damage	Trees present in numbers, usually as groups or woodlands, so they form distinct landscape features which attract a higher collective rating than they might as individuals. But which are not, individually, essential components of formal or semi-formal arboricultural features. For example, trees of moderate quality within an avenue that includes better, A category specimens. Or trees which are internal to the site, therefore individually having little visual impact on the wider locality	Trees with clearly identifiable conservation or other cultural benefits	Blue
Category C Those trees of low quality and value: currently in adequate condition to remain until new planting could be established - a minimum of 10 years is suggested - or young trees with a stem diameter below 150 mm	Trees not qualifying in higher categories Note – Whilst C category trees will usually not t trees with a stem diameter of less than 150mm	Trees present in groups or woodlands, but without this conferring on them significantly greater landscape value, and/or trees offering low or only temporary screening benefit be retained where they would impose a significant of	Trees with very limited conservation or other cultural benefits constraint on development, young	Grey

### BS5837:2012 Table 1 – Cascade Chart for Tree Quality Assessment

# - TEMPORARY PROTECTIVE FENCING SPECIFICATION -

**Construction Exclusion Zones (CEZs)**, enclosed by **Temporary Protective Fencing**, as detailed below and to be agreed with the Local Planning Authority (LPA), shall:

- 1. be retained in place throughout the development process, as specified in the 'Temporary Protective Fencing Construction' section below and detailed in BS5837:2012 Figure 2 (overleaf);
- 2. be sited in the area(s) defined by the Root Protection Areas or, if applicable, the Construction Exclusion Zones, as detailed on the associated Tree Plan;
- 3. be erected prior to any construction, demolition or excavation works and remain in place for the duration of the project;
- 4. preclude any delivery of site accommodation and/or materials and/or plant machinery;
- 5. preclude all construction related activity, with the sole exception of specified arboricultural works and any other works to be carried out under supervision that have been agreed by all parties; and
- 6. preclude the storage of all development related materials and substances including fuels, oils, additives, cement and/or any other deleterious substance.

Any incursion into CEZs must be by prior arrangement, following consultation with the LPA.

### **Temporary Protective Fencing Construction**

- 1. Temporary protective fencing panels shall be weldmesh "Heras" panels of at least 2.0 metres in height.
- 2. The panels shall butt together and be securely fixed to a scaffold framework, as per 3 to 5 below.
- 3. The scaffold framework shall comprise of upright poles of at least 3.0 metres in length driven no less than 0.6 metres into the ground at maximum 3.0 metre centres with horizontal and diagonal poles fixed to the uprights, as per 4 to 5 below.
- 4. The two horizontal rail poles shall be attached to the uprights at heights of 0.6 and 1.8 metres with 3 no. clamps to each joint.
- 5. The diagonal scaffold pole struts be clamped to the top rail of the scaffold framework at a 45° angle and extend back into the CEZ and clamped to a 0.7 metre length of scaffold tube that shall be driven no less than 0.5m into the ground.
- 6. No fixing shall be made to any tree and all possible precautions shall be taken to prevent damage to tree roots when locating posts.
- 7. A 600mm x 300mm warning sign reading "TREE PROTECTION AREA KEEP OUT" (see Figure 1, below) shall be fixed to every 10.0 metre length of protective fencing.
- 8. On completion and prior to any demolition or construction works, site preparation, excavation or delivery of plant and materials, the LPA shall inspect and approve the Temporary Protective Fencing.

Figure 1: CEZ Warning Sign

– TREE PROTECTION AREA –
KEEP OUT!
(TOWN & COUNTRY PLANNING ACT 1990)
THE TREES ENCLOSED BY THIS FENCE ARE PROTECTED BY PLANNING
CONDITIONS AND/OR SUBJECTS OF A 'TREE PRESERVATION ORDER', THE
CONTRAVENTION OF WHICH MAY LEAD TO CRIMINAL PROSECUTION
THE FOLLOWING MUST BE OBSERVED BY ALL PERSONNEL:
THE PROTECTIVE FENCING MUST <u>NOT</u> BE MOVED
<ul> <li>NO PERSON SHALL ENTER THE CONSTRUCTION EXCLUSION ZONE</li> </ul>
<ul> <li>NO MACHINE, PLANT OR VEHICLES SHALL ENTER THE EXCLUSION ZONE</li> </ul>
• NO MATERIALS SHALL BE STORED IN THE EXCLUSION ZONE
<ul> <li>NO SPOIL SHALL BE DEPOSITED IN THE EXCLUSION ZONE</li> </ul>
<ul> <li>NO EXCAVATION SHALL OCCUR IN THE EXCLUSION ZONE</li> </ul>
NO FIRES SHALL BE LIT IN THE EXCLUSION ZONE
ANY INCURSION INTO THE EXCLUSION ZONE MUST BE WITH THE
WRITTEN PERMISSION OF THE LOCAL PLANNING AUTHORITY

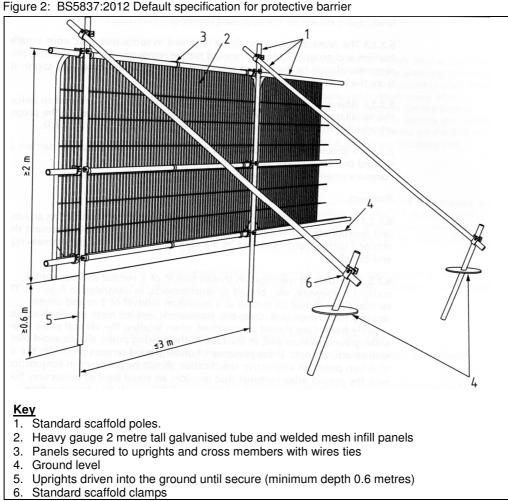


Figure 2: BS5837:2012 Default specification for protective barrier



### **Temporary Ground Protection**

- 1. Any necessary Temporary Ground Protection areas shall conform to Figure 3, below, unless otherwise agreed with the LPA.
- 2. The Ground Protection Area shall be left undisturbed and covered by a semi-permeable geotextile membrane which shall, in turn, be covered by a compressible layer consisting of a material such as woodchip.
- 3. Side-butting scaffold boards shall then be fitted to cover the Ground Protection Area.
- 4. On completion of installation, and prior to any demolition or construction works, site preparation, excavation or delivery of plant and materials, the Consulting Arboriculturist or the LPA Tree Officer, as agreed, shall inspect the Temporary Ground Protection.
- 5. The Temporary Ground Protection shall remain in place until completion of the project and only removed following receipt of written permission from the LPA.

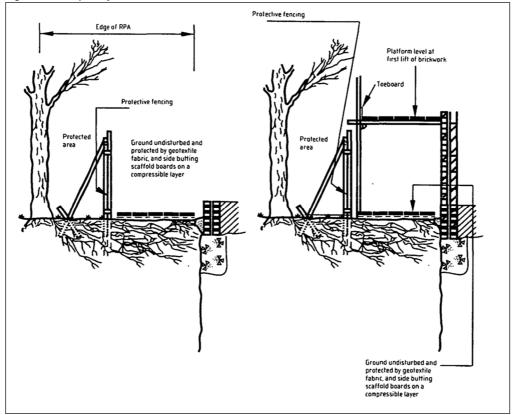


Figure 3: Temporary Ground Protection – Recommended Construction



