



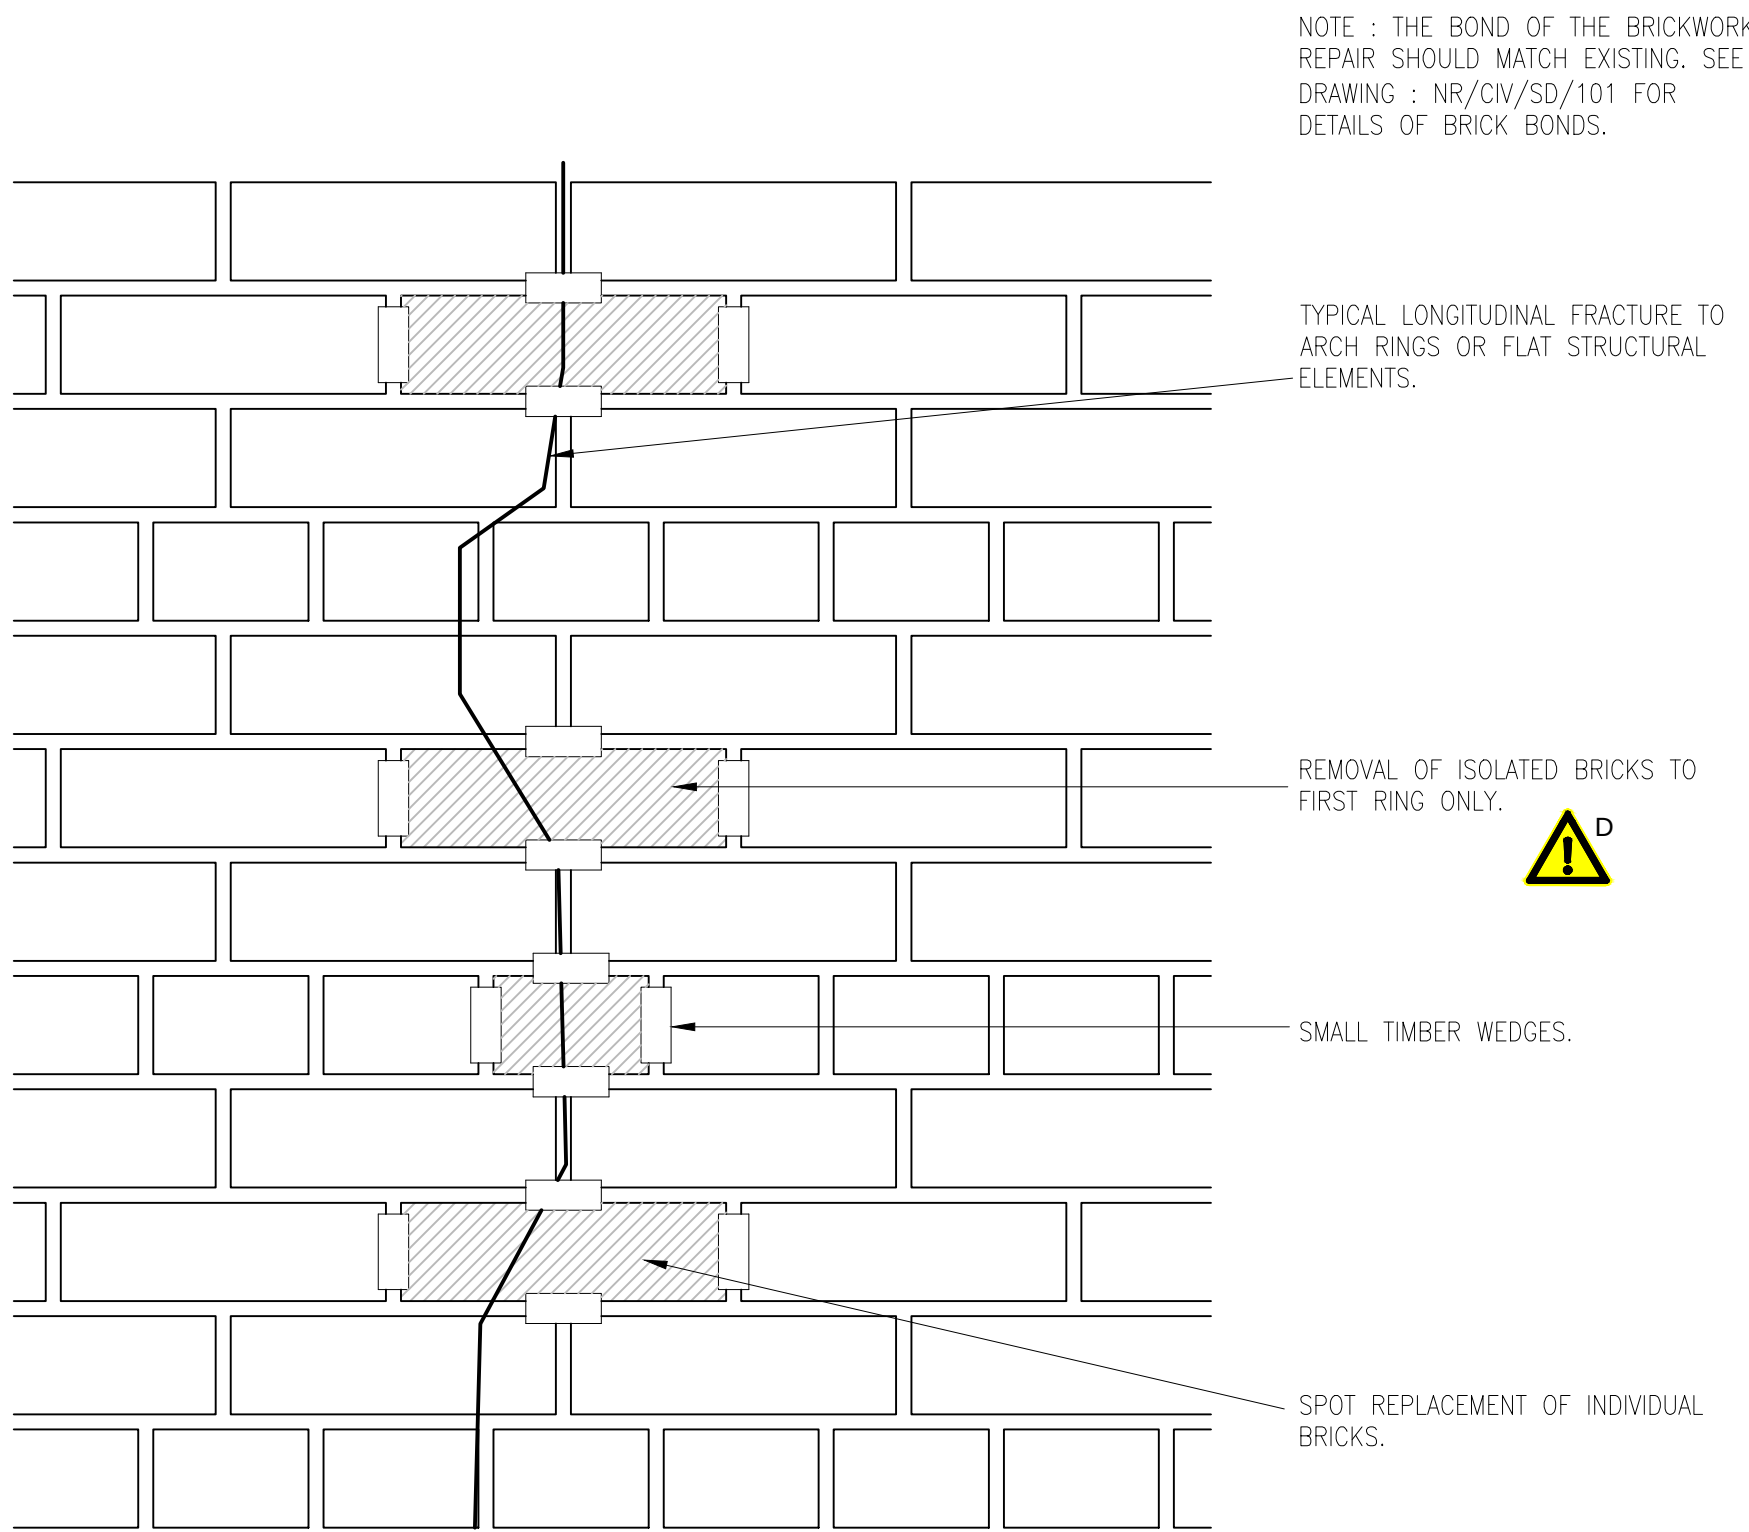

ELEVATION SPOT REPLACEMENT OF BRICKS
IN ENGLISH BOND

SCALE 1 : 5

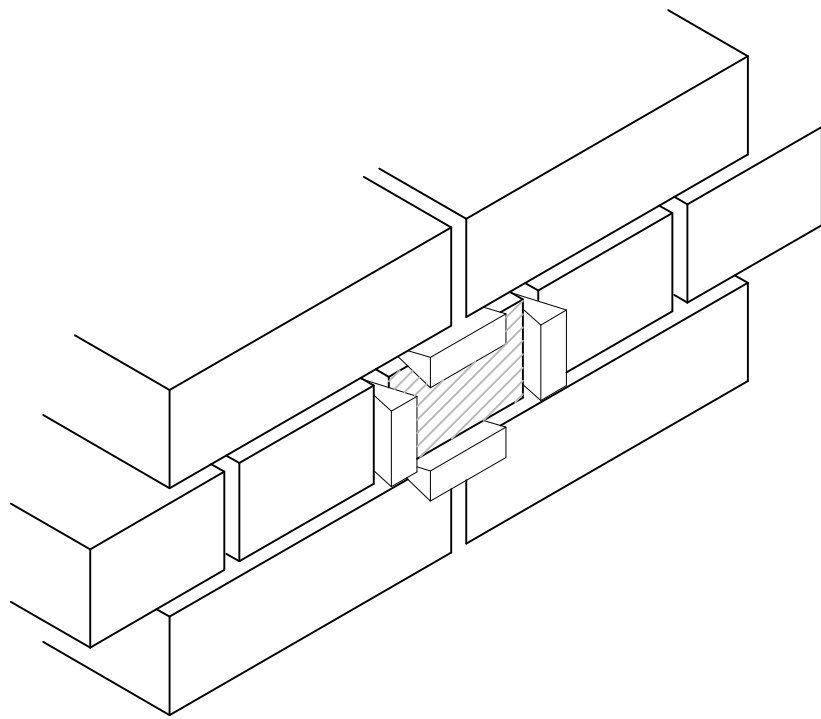

ISOMETRIC VIEW SHOWING TIMBER
WEDGES USED TO SECURE SPOT
REPLACEMENT OF BRICKS

NOT TO SCALE

INSTALLATION GUIDANCE

- a) WHERE WATER INGRESS OR OTHER DEFECTS PREVENT THE USE OF LIME MORTAR AS DESCRIBED IN DRAWING 101, THEN PROPRIETARY PRODUCTS SHOULD BE USED. THESE SHOULD HAVE THE FOLLOWING PROPERTIES:
- ANTI-WASHOUT
 - LOW STRENGTH, TYPICALLY 15–20N/mm²
 - HIGHLY THIXOTROPIC
 - EARLY INITIAL SET
 - SIMILAR MODULUS TO LIME MORTAR
 - SHRINKAGE COMPENSATED
 - EASY TO USE AND HANDLE ON SITE
 - MINIMAL TOXICITY
- b) BRICKS TO BE REPLACED ALONG LENGTH OF CRACK WHEREVER A FULL BREAK HAS OCCURRED. THIS WILL BE AT THE DISCRETION OF THE EMPLOYERS REPRESENTATIVE.
- c) THE SURROUNDING BRICKWORK SHALL BE WETTED FIRSTLY BEFORE RE-POINTING IS CARRIED OUT. THE CRACK AND ANY POOR MORTAR JOINTS WITHIN THE CLEANED AREA TO BE RAKED OUT TO A MIN DEPTH OF 25mm/SOUND MATERIAL. ALL PREPARED JOINTS SHALL BE FREE OF VEGETATION AND OTHER MINERAL DEPOSITS.
- d) POINTING SHALL BE CARRIED OUT WHILE THE MORTAR IS STILL GREEN EITHER BY HAND POINTED OR BY ANY APPROVED MECHANICAL METHOD. JOINTS TO BE FLUSH POINTED CUT AND STRUCK TO MATCH EXISTING DEPENDING ON LOCATION. ALL MORTAR TO MATCH THE EXISTING IN COLOUR. WHERE JOINTS OF NEGLIGIBLE MORTAR EXIST ("PENCIL JOINTS"), EVERY EFFORT MUST BE MADE TO MATCH THE EXISTING, COURSE FOR COURSE.

NOTES

GENERAL

- INDIVIDUAL BRICKS ARE TO BE REPLACED DEPENDING ON THE CONDITION OF BRICKWORK AND THE LENGTH OF CRACK.
- THE EXTENT OF REPAIR WILL BE DECIDED BY THE EMPLOYERS REPRESENTATIVE ON SITE.
- GENERALLY SMALL ISOLATED AREAS OF REPAIR WOULD NOT NECESSITATE THE NEED FOR FORMWORK SUPPORT. SMALL WEDGES SECURING THE PERPENDICULAR AND BED JOINTS SHOULD SUFFICE UNTIL STRIKING UP OF THE JOINTS CAN BE ACHIEVED.

SPECIFICATION

REFER TO DRAWING NR/CIV/SD/101.

HAZARD IDENTIFICATION

REFER TO DRAWING NR/CIV/SD/101



REFER TO DRAWING
NR-CIV-SD-101 FOR SAFETY
HEALTH AND
ENVIRONMENTAL
INFORMATION

B	NOV 2015	AMENDED AGAINST CDM 2015 & S&D	SD	IS
A	22.06.06	FIRST ISSUE –NR APPROVED	RMA	NGAY
P3	17.03.06	REVISED FORM B.	RMA	NGAY
P2	31.01.06	FORM B ISSUE.	RMA	NGAY
P1	13.01.06	PRELIMINARY DRAFT	RMA	NGAY
Rev	Date	Description of revision	Design'd	C'kd



40 Melton Street
London NW1 2EE

Tel: 020-7557-8000

Approved	P. CLARK	Programme Eng. Manager Civils, MP & I	PC	25.05.06
Authorised	K. TEAGER	Director of Civil Engineering	KT	08.06.06
	Name	Position	Signature	Date


Master copy with original signatures held by Network Rail HQ
CIVIL ENGINEERING STANDARD DESIGN

© COPYRIGHT NETWORK RAIL 2006

BRICK AND MASONRY REPAIR
STANDARD DRAWINGS

SPOT REPLACEMENT
OF BRICKS

Scale	AS SHOWN	REV.
Drawing Number	NR/CIV/SD/111	B

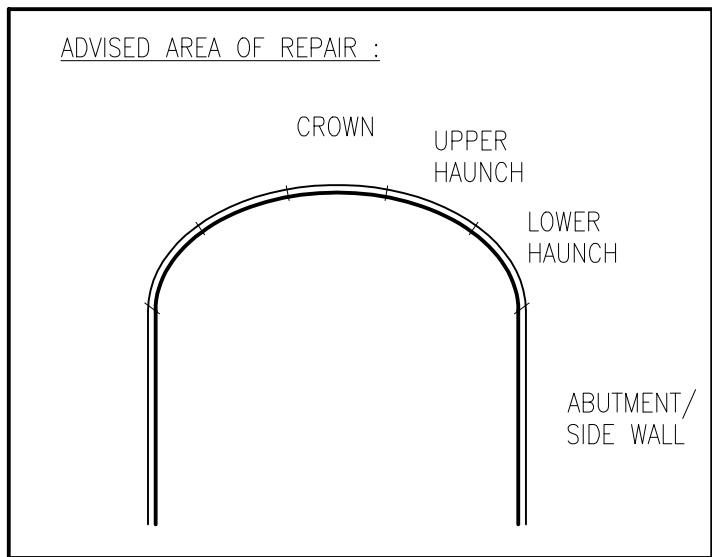

AREA APPROPRIATE FOR DETAILED
REPAIR IS SHOWN BY HEAVY LINE.