

Drawn:	Date:	Title:	Drawing No:	Revision:
JI	08/ 25	CRANE WOOD FARM BARN	137CW-02-02	D
Scale: 1/50 @ A3				
<b>ROOF STRUCTURE AS PROPOSED</b>				


James Innerdale Architect . 5 Gildersbank . Clapham . Lancaster . LA2 8EG . t: 07743100941 . e: jamesinnerdale@yahoo.co.uk



ALLOW FOR REPLACEMENT OF 60% OF THE RAFTERS FROM THE LOWER PURLIN TO THE WALL TOP. WHERE NEW RAFTERS ARE ROTTEN RETAIN INSITU AND SIT NEW ALONGSIDE

C20TH LEANTO NOT INCLUDED IN THE PROPOSALS

\* NEW 50 X 100 C24 SWD RAFTERS @ 400 CENTRES ACROSS WHOLE ROOF OF THE MAIN BARN

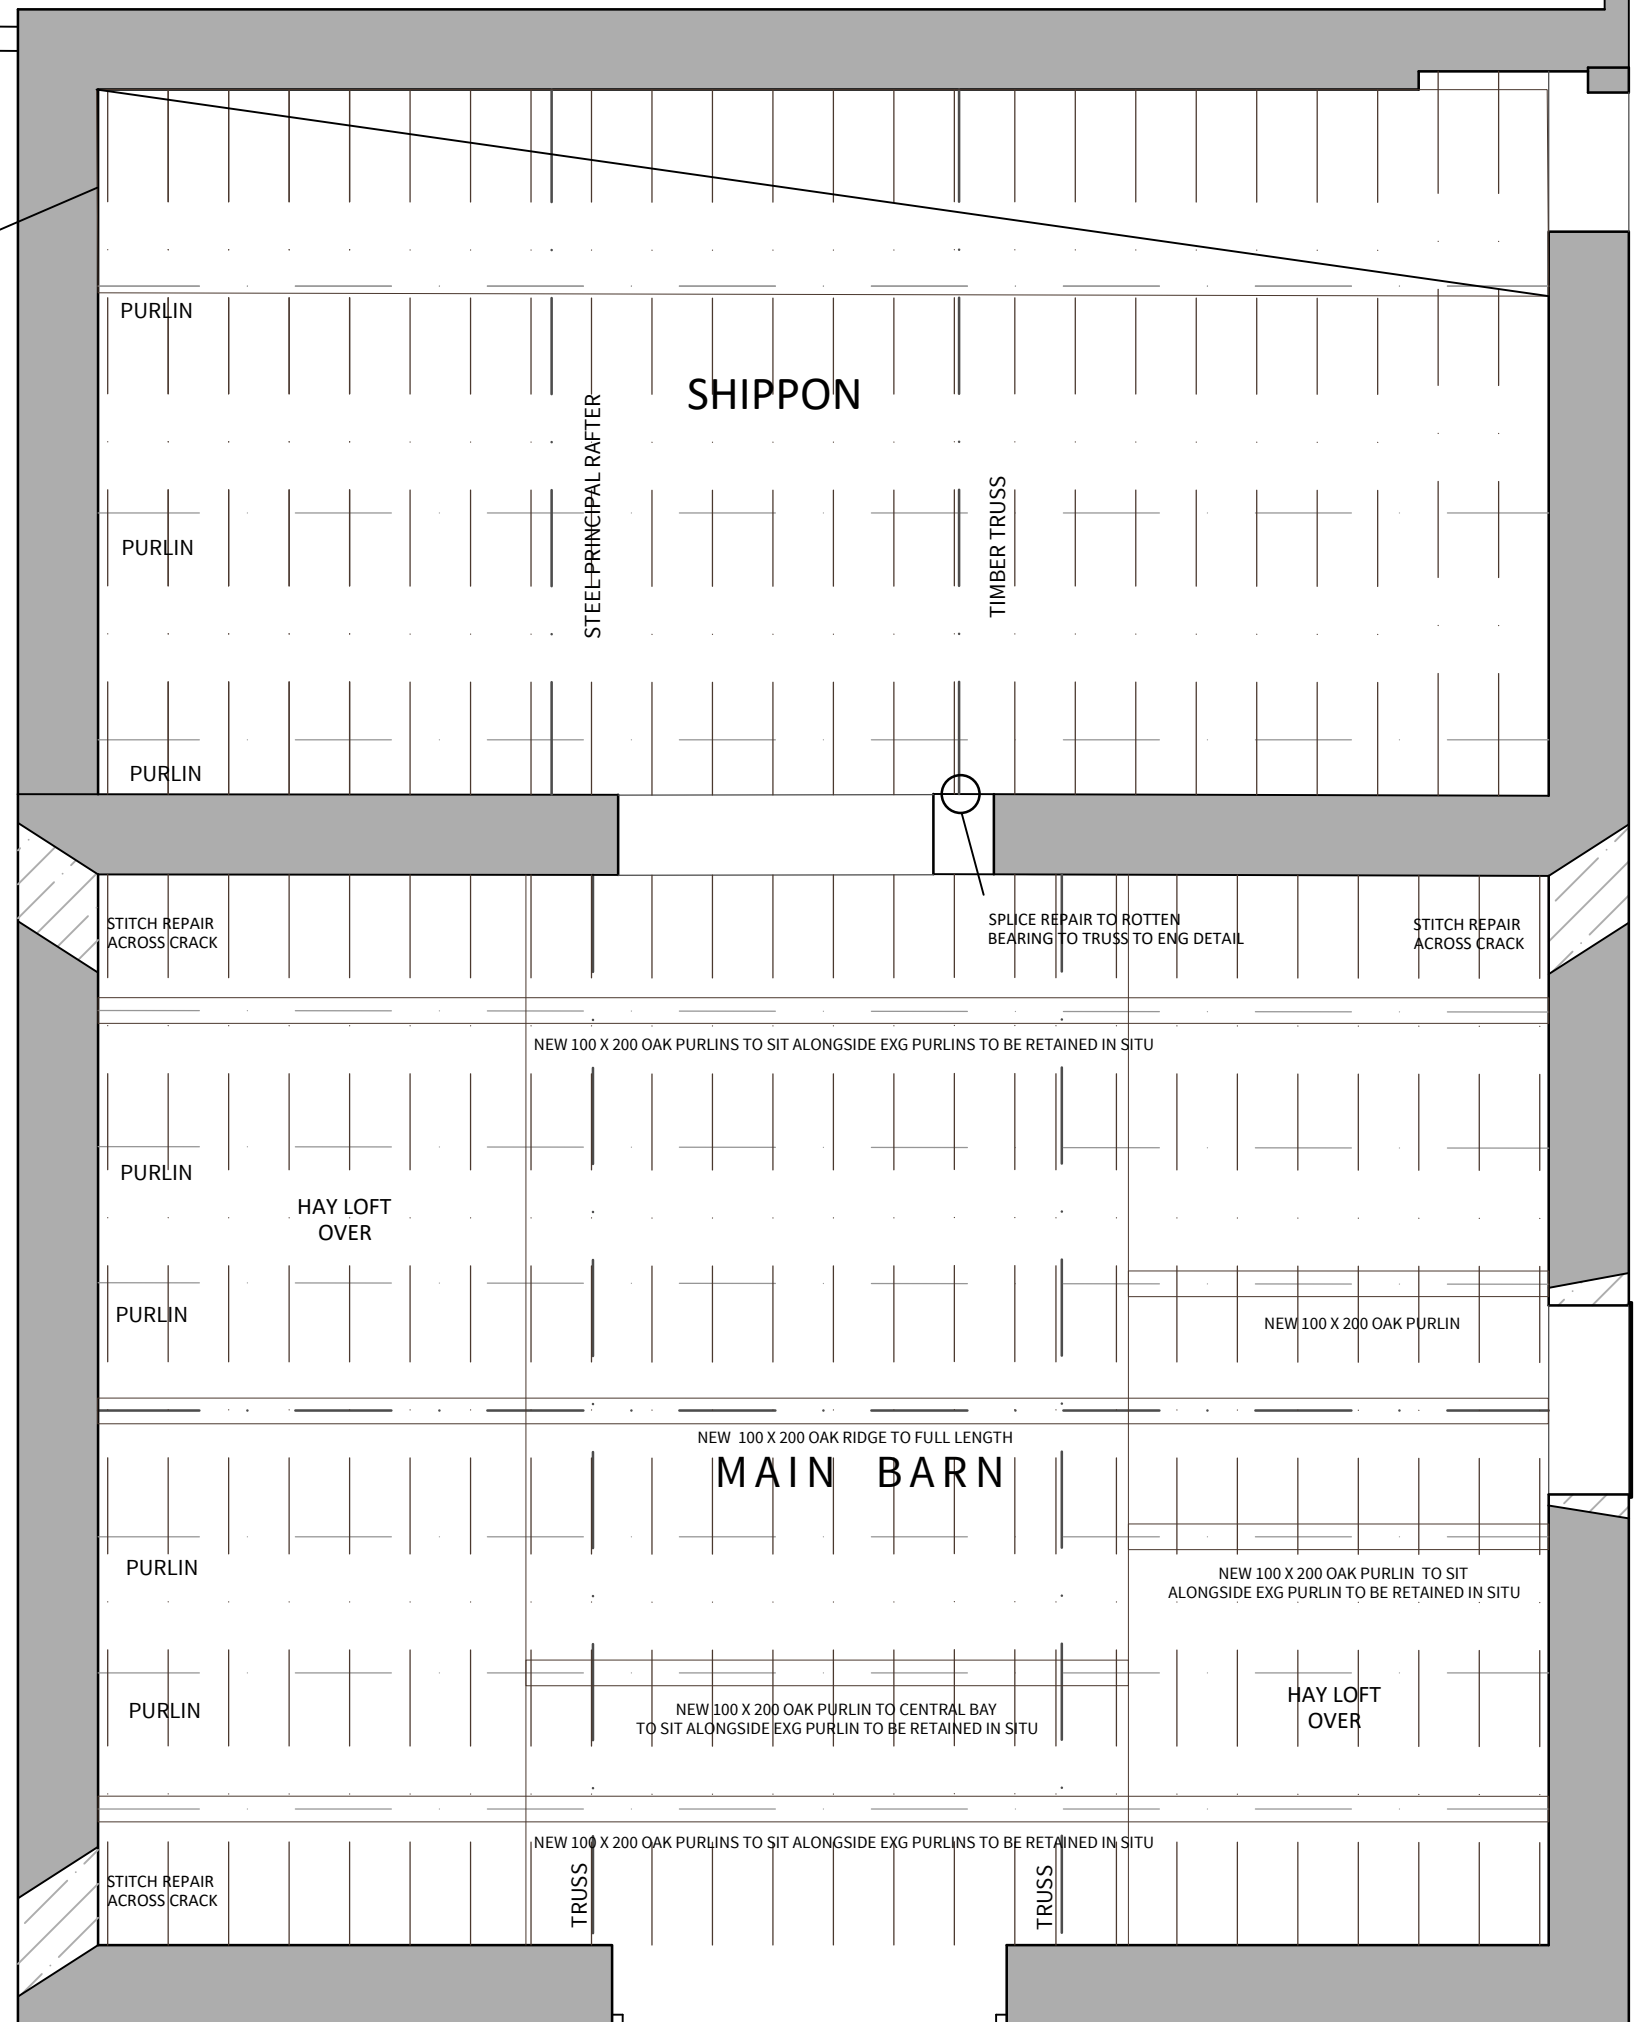

STITCH REPAIR ACROSS CRACK

SPLICE REPAIR TO ROTTEN BEARING TO TRUSS TO ENG DETAIL

STITCH REPAIR ACROSS CRACK

NEW 100 X 200 OAK PURLINS TO SIT ALONGSIDE EXG PURLINS TO BE RETAINED IN SITU

NEW 100 X 200 OAK PURLIN

NEW 100 X 200 OAK RIDGE TO FULL LENGTH

NEW 100 X 200 OAK PURLIN TO SIT ALONGSIDE EXG PURLIN TO BE RETAINED IN SITU

NEW 100 X 200 OAK PURLIN TO CENTRAL BAY TO SIT ALONGSIDE EXG PURLIN TO BE RETAINED IN SITU

NEW 100 X 200 OAK PURLINS TO SIT ALONGSIDE EXG PURLINS TO BE RETAINED IN SITU

NEW STONE REVEALS TO PITCHING WINDOW

REPAIR & RETAIN EXG SHUTTER & HINGES TO EXTERNAL FACE