

Drawn:	Date:	Title:	Drawing No:	Revision:
JI	08/ 25	CRANE WOOD FARM BARN	137CW-02-02	C
Scale: 1/50 @ A3				
<b>ROOF STRUCTURE AS PROPOSED</b>				


James Innerdale Architect . 5 Gildersbank . Clapham . Lancaster . LA2 8EG . t: 07743100941 . e: jamesinnerdale@yahoo.co.uk



ALLOW FOR REPLACEMENT OF 60% OF THE RAFTERS FROM THE LOWER PURLIN TO THE WALL TOP. WHERE NEW RAFTERS ARE ROTTEN RETAIN INSITU AND SIT NEW ALONGSIDE

C20TH LEANTO NOT INCLUDED IN THE PROPOSALS

\* NEW 50 X 100 C24 SWD RAFTERS @ 400 CENTRES ACROSS WHOLE ROOF OF THE MAIN BARN

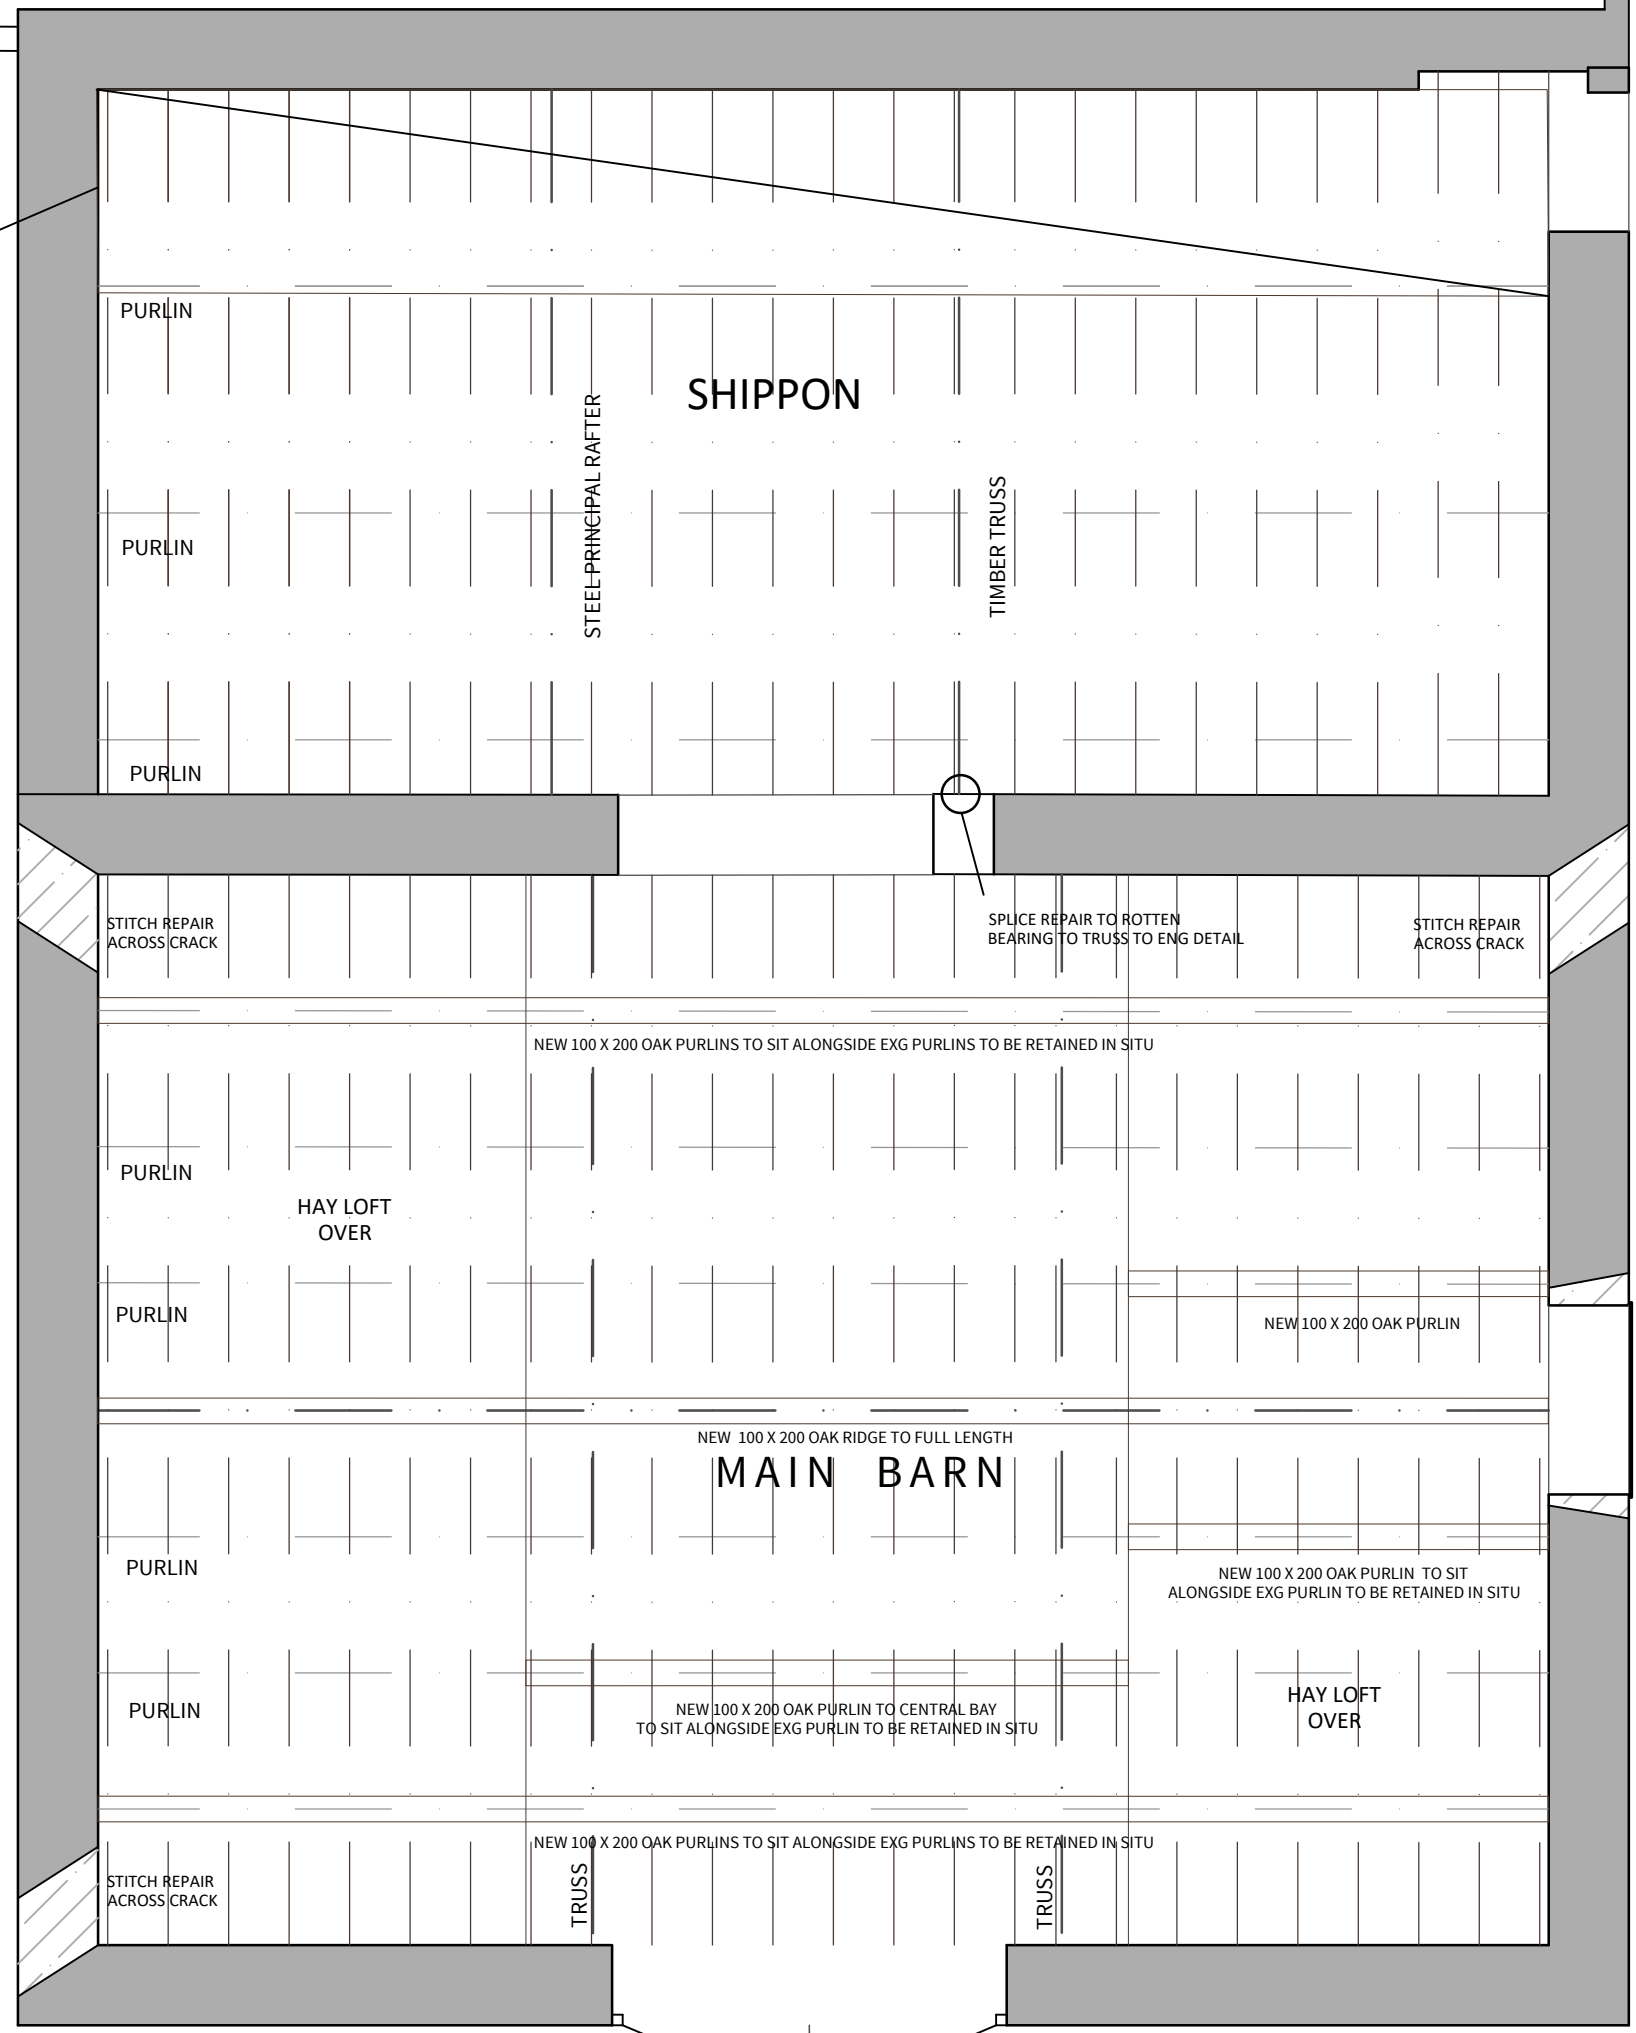

STITCH REPAIR ACROSS CRACK

NEW STONE REVEALS TO PITCHING WINDOW

NEW SHUTTER TO EXTERNAL FACE

PURLIN

PURLIN

PURLIN

STITCH REPAIR ACROSS CRACK

PURLIN

PURLIN

PURLIN

PURLIN

STITCH REPAIR ACROSS CRACK

SHIPPON

STEEL PRINCIPAL RAFTER

TIMBER TRUSS

SPLICE REPAIR TO ROTTEN BEARING TO TRUSS TO ENG DETAIL

NEW 100 X 200 OAK PURLINS TO SIT ALONGSIDE EXG PURLINS TO BE RETAINED IN SITU

HAY LOFT OVER

NEW 100 X 200 OAK PURLIN

NEW 100 X 200 OAK RIDGE TO FULL LENGTH

MAIN BARN

NEW 100 X 200 OAK PURLIN TO SIT ALONGSIDE EXG PURLIN TO BE RETAINED IN SITU

HAY LOFT OVER

NEW 100 X 200 OAK PURLIN TO CENTRAL BAY TO SIT ALONGSIDE EXG PURLIN TO BE RETAINED IN SITU

NEW 100 X 200 OAK PURLINS TO SIT ALONGSIDE EXG PURLINS TO BE RETAINED IN SITU

TRUSS

TRUSS