

REFERENCE F1DATE 25.09.2023LOCATION MITTON ROAD, WHALLEYCARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐**COVER SHAPE**

OTHER _____

HEAVY DUTY ☒MEDIUM DUTY ☐LIGHT DUTY ☐SIZE 600 x 600**COVER CONDITION**OK ☐ATTENTION REQUIRED ☒DAMAGED COVER**CHAMBER**

REGULATING COURSE OK



ATTENTION REQUIRED



SHAFT OK



ATTENTION REQUIRED



CHAMBER OK



ATTENTION REQUIRED



BENCHING / CHANNEL OK



ATTENTION REQUIRED



STEP IRONS / LADDER OK



ATTENTION REQUIRED

SIZE 1350 MM5 STEPS**CONSTRUCTION**BRICK ☐PRECAST ☒INSITU CONC. ☐PVC ☐OTHER ☐**SERVICE**

SILT / DEBRIS



DEPTH _____ mm

INFILTRATION

VERMIN ☐

SURCHARGE EVIDENT



DEPTH _____ mm

TOXIC ATMOSPHERE

**USE**FOUL ☒SURFACE WATER ☐COMBINED ☐WATERCOURSE ☐T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	<u>1960</u>				
(III) SIZE (mm)	<u>150</u>				
(IV) MATERIAL	<u>CLAY</u>				
(V) BACKDROP (mm)	<u>N/A</u>				

OUTGOING PIPES		
X	Y	Z
<u>2000</u>		
<u>150</u>		
<u>CLAY</u>		
<u>N/A</u>		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372623.5036</u> Northing (Y): <u>437202.3278</u>	

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>1</u>	<u>PRO-AB-14-A</u>	<u>JW</u>

REFERENCE F2

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐
COVER SHAPE ☐ ☒ ☐ ☐ ☐ ☐ OTHER _____

HEAVY DUTY ☐ MEDIUM DUTY ☐ LIGHT DUTY ☐ SIZE 600x600
COVER CONDITION OK ☒ ATTENTION REQUIRED ☐
CHAMBER

REGULATING COURSE	OK	☒	ATTENTION REQUIRED	☐	
SHAFT	OK	☒	ATTENTION REQUIRED	☐	
CHAMBER	OK	☒	ATTENTION REQUIRED	☐	SIZE <u>1200MM</u>
BENCHING / CHANNEL	OK	☒	ATTENTION REQUIRED	☐	
STEP IRONS / LADDER	OK	☒	ATTENTION REQUIRED	☐	<u>9 STEPS</u>

CONSTRUCTION

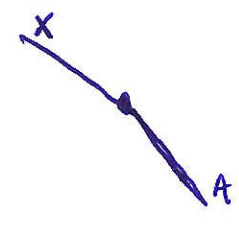
BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐
SERVICE

SILT / DEBRIS ☒ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
SURCHARGE EVIDENT ☒ DEPTH _____ mm TOXIC ATMOSPHERE ☐
USE

FOUL ☒ SURFACE WATER ☐ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	<u>2800</u>				
(III) SIZE (mm)	<u>150</u>				
(IV) MATERIAL	<u>CLAY</u>				
(V) BACKDROP (mm)	<u>N/A</u>				

OUTGOING PIPES		
X	Y	Z
<u>2840</u>		
<u>150</u>		
<u>CLAY</u>		
<u>N/A</u>		

DETAILS 	OSGB LOCATION OF MANHOLE COVER Easting (X): <u>372634.6045</u> Northing (Y): <u>437252.4028</u>	COMMENTS
---	--	-----------------

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>2</u>	<u>PRO-AB-14-A</u>	<u>SW</u>

REFERENCE F3

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE



OTHER _____

HEAVY DUTY ☒

MEDIUM DUTY ☐

LIGHT DUTY ☐

SIZE 600x600

COVER CONDITION

OK ☒

ATTENTION REQUIRED ☐

CHAMBER

REGULATING COURSE OK ☒

SHAFT OK ☒

CHAMBER OK ☒

BENCHING / CHANNEL OK ☒

STEP IRONS / LADDER OK ☒

ATTENTION REQUIRED ☐

ATTENTION REQUIRED ☐

ATTENTION REQUIRED ☐

ATTENTION REQUIRED ☐

ATTENTION REQUIRED ☐

SIZE 1200MM

12 STEPS

CONSTRUCTION

BRICK ☐

PRECAST ☒

INSITU CONC. ☐

PVC ☐

OTHER ☐

SERVICE

SILT / DEBRIS ☒

SURCHARGE EVIDENT ☒

DEPTH _____ mm

DEPTH _____ mm

INFILTRATION ☐

TOXIC ATMOSPHERE ☐

VERMIN ☐

USE

FOUL ☒

SURFACE WATER ☐

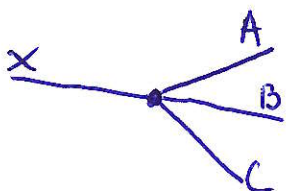
COMBINED ☐

WATERCOURSE ☐

T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3660	3660	3620		
(III) SIZE (mm)	150	150	150		
(IV) MATERIAL	CLAY	CLAY	CLAY		
(V) BACKDROP (mm)	N/A	N/A	N/A		

OUTGOING PIPES		
X	Y	Z
3680		
150		
CLAY		
N/A		

DETAILS 	OSGB LOCATION OF MANHOLE COVER Easting (X): <u>372604.4629</u> Northing (Y): <u>437260.4574</u>	COMMENTS
--	--	-------------------

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>3</u>	<u>PRO.AB.14-A</u>	<u>JW</u>

REFERENCE f4

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE ☒ ☐ ☐ ☒ ☐ ☐ OTHER _____

HEAVY DUTY ☒ MEDIUM DUTY ☐ LIGHT DUTY ☐ SIZE 1200 x 675

COVER CONDITION OK ☒ ATTENTION REQUIRED ☐

CHAMBER

REGULATING COURSE	OK	☒	ATTENTION REQUIRED	☐	
SHAFT	OK	☒	ATTENTION REQUIRED	☐	
CHAMBER	OK	☒	ATTENTION REQUIRED	☐	
BENCHING / CHANNEL	OK	☒	ATTENTION REQUIRED	☒	SIZE <u>1350 mm</u>
STEP IRONS / LADDER	OK	☒	ATTENTION REQUIRED	☐	<u>CONCRETE SPOIL</u>
					<u>2 STEPS</u>

CONSTRUCTION

BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐

SERVICE

SILT / DEBRIS ☒ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
 SURCHARGE EVIDENT ☒ DEPTH _____ mm TOXIC ATMOSPHERE ☐

USE

FOUL ☒ SURFACE WATER ☐ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	1330				
(III) SIZE (mm)	150				
(IV) MATERIAL	CLAY				
(V) BACKDROP (mm)	N/A				

OUTGOING PIPES		
X	Y	Z
1350		
150		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372639.2695 Northing (Y): 437432.0635	CONCRETE SPOIL IN CHANNEL

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
4	PRO. AB. 14-A	SW



REFERENCE

f5

DATE 25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☒

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☐

COVER SHAPE



OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

1200 x 675

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☒

ATTENTION REQUIRED

☐

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☒

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

1200MM

CONCRETE SPOIL

1 STEP

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☒

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☒

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☒

SURFACE WATER

☐

COMBINED

☐

WATERCOURSE

☐

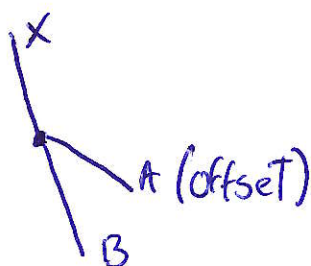
T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	1300	1270			
(III) SIZE (mm)	150	150			
(IV) MATERIAL	CLAY	CLAY			
(V) BACKDROP (mm)	N/A	N/A			

OUTGOING PIPES		
X	Y	Z
1320		
150		
CLAY		
N/A		

DETAILS



OSGB LOCATION OF MANHOLE COVER

Easting (X):

372 627.7047

Northing (Y):

437455.2039

COMMENTS

CONCRETE SPOIL IN CHANNEL

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
5	PRO. AB. 14-A	SW

REFERENCE F6

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐
COVER SHAPE


OTHER _____

HEAVY DUTY ☒

MEDIUM DUTY ☐

LIGHT DUTY ☐

SIZE 600x600
COVER CONDITION

OK ☒

ATTENTION REQUIRED ☐
CHAMBER

REGULATING COURSE OK ☒

SHAFT OK ☒

CHAMBER OK ☒

BENCHING / CHANNEL OK ☒

STEP IRONS / LADDER OK ☒

ATTENTION REQUIRED ☐

ATTENTION REQUIRED ☐

ATTENTION REQUIRED ☐

ATTENTION REQUIRED ☒

ATTENTION REQUIRED ☐

SIZE 1200MM
CONCRETE SPOIL
4 STEPS
CONSTRUCTION

BRICK ☐

PRECAST ☒

INSITU CONC. ☐

PVC ☐

OTHER ☐
SERVICE

SILT / DEBRIS ☒

SURCHARGE EVIDENT ☒

DEPTH _____ mm

DEPTH _____ mm

INFILTRATION ☐

TOXIC ATMOSPHERE ☐

VERMIN ☐
USE

FOUL ☒

SURFACE WATER ☐

COMBINED ☐

WATERCOURSE ☐

T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	1600				
(III) SIZE (mm)	150				
(IV) MATERIAL	CLAY				
(V) BACKDROP (mm)	N/A				

OUTGOING PIPES		
X	Y	Z
1650		
150		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372625.2479 Northing (Y): 437465.3313	CONCRETE SPOIL IN CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
6	PRO. AB.14-A	JW

REFERENCE F7

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐
COVER SHAPE ☐ ☒ ☐ ☐ ☐ ☐ ☐ OTHER _____

HEAVY DUTY ☒ MEDIUM DUTY ☐ LIGHT DUTY ☐ SIZE 600 x 600
COVER CONDITION OK ☒ ATTENTION REQUIRED ☐
CHAMBER

REGULATING COURSE	OK	☒	ATTENTION REQUIRED	☐	
SHAFT	OK	☒	ATTENTION REQUIRED	☐	
CHAMBER	OK	☒	ATTENTION REQUIRED	☐	
BENCHING / CHANNEL	OK	☒	ATTENTION REQUIRED	☒	SIZE <u>1200MM</u>
STEP IRONS / LADDER	OK	☒	ATTENTION REQUIRED	☐	<u>CONCRETE SPOIL</u>
					<u>5 STEPS</u>

CONSTRUCTION

BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐
SERVICE

SILT / DEBRIS ☒ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
SURCHARGE EVIDENT ☒ DEPTH _____ mm TOXIC ATMOSPHERE ☐
USE

FOUL ☒ SURFACE WATER ☐ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	2160	2150			
(III) SIZE (mm)	150	150			
(IV) MATERIAL	CLAY	CLAY			
(V) BACKDROP (mm)	N/A	N/A			

OUTGOING PIPES		
X	Y	Z
2190		
150		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372629.6335</u> Northing (Y): <u>437477.8659</u>	CONCRETE SPOIL IN CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>7</u>	<u>PRO. AB.14-A</u>	<u>SW</u>

REFERENCE F8

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE



OTHER _____

HEAVY DUTY ☐

MEDIUM DUTY ☐

LIGHT DUTY ☐

SIZE 600 x 600

COVER CONDITION

OK ☒

ATTENTION REQUIRED ☐

CHAMBER

REGULATING COURSE OK ☒
SHAFT OK ☒
CHAMBER OK ☒
BENCHING / CHANNEL OK ☒
STEP IRONS / LADDER OK ☒

ATTENTION REQUIRED ☐
ATTENTION REQUIRED ☐
ATTENTION REQUIRED ☐
ATTENTION REQUIRED ☒
ATTENTION REQUIRED ☐

SIZE 1200 mm
CONCRETE SPOIL
7 STEPS

CONSTRUCTION

BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐

SERVICE

SILT / DEBRIS ☒ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
SURCHARGE EVIDENT ☒ DEPTH _____ mm TOXIC ATMOSPHERE ☐

USE

FOUL ☒ SURFACE WATER ☐ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	<u>2600</u>				
(III) SIZE (mm)	<u>150</u>				
(IV) MATERIAL	<u>CLAY</u>				
(V) BACKDROP (mm)	<u>N/A</u>				

OUTGOING PIPES		
X	Y	Z
<u>2640</u>		
<u>150</u>		
<u>CLAY</u>		
<u>N/A</u>		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372632.2634</u> Northing (Y): <u>437490.3599</u>	<u>CONCRETE SPOIL IN CHAMBER</u>

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>8</u>	<u>PRO.AB.14.A</u>	<u>SW</u>

REFERENCE F9 DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE ☐ ☐ ☐ ☒ ☐ ☐ OTHER _____

HEAVY DUTY ☐ MEDIUM DUTY ☐ LIGHT DUTY ☐ SIZE 1200x675

COVER CONDITION OK ☒ ATTENTION REQUIRED ☐

CHAMBER

REGULATING COURSE	OK	☒	ATTENTION REQUIRED	☐	
SHAFT	OK	☒	ATTENTION REQUIRED	☐	
CHAMBER	OK	☒	ATTENTION REQUIRED	☐	
BENCHING / CHANNEL	OK	☒	ATTENTION REQUIRED	☒	SIZE <u>1350MM</u>
STEP IRONS / LADDER	OK	☒	ATTENTION REQUIRED	☐	<u>CONCRETE SPOIL</u>
					<u>2 STEPS</u>

CONSTRUCTION

BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐

SERVICE

SILT / DEBRIS ☒ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
SURCHARGE EVIDENT ☒ DEPTH _____ mm TOXIC ATMOSPHERE ☐

USE

FOUL ☒ SURFACE WATER ☐ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	1460				
(III) SIZE (mm)	150				
(IV) MATERIAL	CLAY				
(V) BACKDROP (mm)	N/A				

OUTGOING PIPES		
X	Y	Z
1550		
150		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372662.7746</u> Northing (Y): <u>437506.1066</u>	<u>CONCRETE SPOIL IN CHANNEL / CHAMBER</u>

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>9</u>	<u>PRO.AB.14-A</u>	<u>JW</u>



REFERENCE

F10

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY



FOOTPATH




VERGE



OUTSIDE HIGHWAY BOUNDARY



COVER SHAPE



OTHER

HEAVY DUTY



MEDIUM DUTY



LIGHT DUTY



SIZE

600x600

COVER CONDITION

OK



ATTENTION REQUIRED




CHAMBER

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK



ATTENTION REQUIRED



CHAMBER

OK



ATTENTION REQUIRED



BENCHING / CHANNEL

OK



ATTENTION REQUIRED



STEP IRONS / LADDER

OK



ATTENTION REQUIRED



SIZE

1200MM

CONCRETE SPOL
8 STEPS

CONSTRUCTION

BRICK



PRECAST



INSITU CONC.



PVC



OTHER



SERVICE

SILT / DEBRIS



DEPTH

mm

INFILTRATION



VERMIN



SURCHARGE EVIDENT



DEPTH

mm

TOXIC ATMOSPHERE



USE

FOUL

SURFACE
WATER

COMBINED



WATERCOURSE



T/EFFLUENT



CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	2720	2700			
(III) SIZE (mm)	150	150			
(IV) MATERIAL	CLAY	CLAY			
(V) BACKDROP (mm)	N/A	N/A			

OUTGOING PIPES		
X	Y	Z
2730		
150		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372632.0645 Northing (Y): 437503.1535	CONCRETE SPOIL IN CHANNEL / CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
10	PRO-AB 14-A	SW

REFERENCE F11 DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE ☒ ☐ ☐ ☐ ☐ ☐ OTHER _____

HEAVY DUTY ☒ MEDIUM DUTY ☐ LIGHT DUTY ☐ SIZE 600 x 600

COVER CONDITION OK ☒ ATTENTION REQUIRED ☐

CHAMBER

REGULATING COURSE	OK	☒	ATTENTION REQUIRED	☐	
SHAFT	OK	☒	ATTENTION REQUIRED	☐	
CHAMBER	OK	☒	ATTENTION REQUIRED	☐	
BENCHING / CHANNEL	OK	☒	ATTENTION REQUIRED	☒	SIZE <u>1200 mm</u>
STEP IRONS / LADDER	OK	☒	ATTENTION REQUIRED	☐	<u>CONCRETE SPOIL</u>
					<u>8 STEPS</u>

CONSTRUCTION

BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐

SERVICE

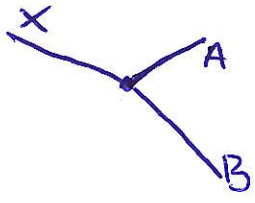
SILT / DEBRIS ☒ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
SURCHARGE EVIDENT ☒ DEPTH _____ mm TOXIC ATMOSPHERE ☐

USE

FOUL ☒ SURFACE WATER ☐ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	2650	2660			
(III) SIZE (mm)	150	150			
(IV) MATERIAL	CLAY	CLAY			
(V) BACKDROP (mm)	N/A	N/A			

OUTGOING PIPES		
X	Y	Z
2700		
150		
CLAY		
N/A		

DETAILS 	OSGB LOCATION OF MANHOLE COVER Easting (X): <u>372626.0847</u> Northing (Y): <u>437528.8008</u>	COMMENTS <u>CONCRETE SPOIL IN CHANNEL</u>
---	--	---

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>11</u>	<u>PRO-AB-14-A</u>	<u>SW</u>



REFERENCE

F12

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY



FOOTPATH



VERGE



OUTSIDE HIGHWAY BOUNDARY



COVER SHAPE



OTHER

HEAVY DUTY



MEDIUM DUTY



LIGHT DUTY



SIZE

600 x 600

COVER CONDITION

OK



ATTENTION REQUIRED




CHAMBER

REGULATING COURSE

OK




ATTENTION REQUIRED




SHAFT

OK




ATTENTION REQUIRED




CHAMBER

OK



ATTENTION REQUIRED



BENCHING / CHANNEL

OK



ATTENTION REQUIRED



STEP IRONS / LADDER

OK



ATTENTION REQUIRED



SIZE

1200mm

8 STEPS

CONSTRUCTION

BRICK



PRECAST



INSITU CONC.



PVC



OTHER



SERVICE

SILT / DEBRIS



DEPTH

mm

INFILTRATION



VERMIN



SURCHARGE EVIDENT



DEPTH

mm

TOXIC ATMOSPHERE



USE

FOUL

SURFACE
WATER

COMBINED



WATERCOURSE



T/EFFLUENT



CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	2640	2650			
(III) SIZE (mm)	150	150			
(IV) MATERIAL	CLAY	CLAY			
(V) BACKDROP (mm)	N/A	N/A			

OUTGOING PIPES		
X	Y	Z
2660		
150		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372588.9939 Northing (Y): 437596.5980	Some Debris

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
12	PRO. AB. 14-A	JW

REFERENCE F13

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☐ FOOTPATH ☐ VERGE ☒ OUTSIDE HIGHWAY BOUNDARY ☐
COVER SHAPE


OTHER _____

HEAVY DUTY ☒

MEDIUM DUTY ☐

LIGHT DUTY ☐

SIZE 600 x 600
COVER CONDITION

OK ☒

ATTENTION REQUIRED ☐
CHAMBER

REGULATING COURSE OK



ATTENTION REQUIRED



SHAFT OK



ATTENTION REQUIRED



CHAMBER OK



ATTENTION REQUIRED



BENCHING / CHANNEL OK



ATTENTION REQUIRED



STEP IRONS / LADDER OK



ATTENTION REQUIRED


SIZE 1200MM
9 STEPS
CONSTRUCTION

BRICK ☐

PRECAST ☒

INSITU CONC. ☐

PVC ☐

OTHER ☐
SERVICE

SILT / DEBRIS ☐

DEPTH _____ mm

INFILTRATION ☐

VERMIN ☐

SURCHARGE EVIDENT ☐

DEPTH _____ mm

TOXIC ATMOSPHERE ☐
USE

FOUL ☒

SURFACE

WATER ☐

COMBINED ☐

WATERCOURSE ☐

T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	2950	2950			
(III) SIZE (mm)	150	150			
(IV) MATERIAL	CLAY	CLAY			
(V) BACKDROP (mm)	N/A	N/A			

OUTGOING PIPES		
X	Y	Z
3000		
150		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372579.5028</u> Northing (Y): <u>437541.9617</u>	


Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>13</u>	<u>PRO. AB. 14-A</u>	<u>SW</u>

REFERENCE F14

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☐ FOOTPATH ☐ VERGE ☒ OUTSIDE HIGHWAY BOUNDARY ☐
COVER SHAPE


OTHER _____

HEAVY DUTY ☐ MEDIUM DUTY ☐ LIGHT DUTY ☐

SIZE 600 x 600
COVER CONDITION

OK ☐ ATTENTION REQUIRED ☐
CHAMBER

REGULATING COURSE OK



ATTENTION REQUIRED

SHAFT OK

ATTENTION REQUIRED

CHAMBER OK

ATTENTION REQUIRED

BENCHING / CHANNEL OK

ATTENTION REQUIRED

STEP IRONS / LADDER OK

ATTENTION REQUIRED

SIZE 1200 MM
7 STEPS
CONSTRUCTION

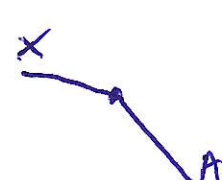
BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐
SERVICE

SILT / DEBRIS ☐ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
SURCHARGE EVIDENT ☐ DEPTH _____ mm TOXIC ATMOSPHERE ☐
USE

FOUL ☒ SURFACE WATER ☐ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3160				
(III) SIZE (mm)	150				
(IV) MATERIAL	CLAY				
(V) BACKDROP (mm)	N/A				

OUTGOING PIPES		
X	Y	Z
3220		
225		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372566.4446</u> Northing (Y): <u>437568.5212</u>	

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
14	PRO.AB.14-A	SW



REFERENCE

S2

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☒

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☐

COVER SHAPE



OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

600x600

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☒

ATTENTION REQUIRED

☐

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

2700mm

6 STEPS

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☐

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☐

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐

SURFACE

WATER

☒

COMBINED

☐

WATERCOURSE

☐

T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)					
(III) SIZE (mm)					
(IV) MATERIAL					
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3670		
1200		
CONC		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372625.2394 Northing (Y): 437196.9614	

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
15	PRO.AB.14-A	SW

REFERENCE S3DATE 25.09.2023LOCATION MITTON ROAD, WHALLEYCARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐**COVER SHAPE**

OTHER _____

HEAVY DUTY ☒MEDIUM DUTY ☐LIGHT DUTY ☐SIZE 600x600**COVER CONDITION**OK ☒ATTENTION REQUIRED ☐**CHAMBER**

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK



ATTENTION REQUIRED



CHAMBER

OK



ATTENTION REQUIRED



BENCHING / CHANNEL

OK



ATTENTION REQUIRED



STEP IRONS / LADDER

OK



ATTENTION REQUIRED

SIZE 2700MM8 STEPS**CONSTRUCTION**BRICK ☐PRECAST ☒INSITU CONC. ☐PVC ☐OTHER ☐**SERVICE**

SILT / DEBRIS



DEPTH _____ mm

INFILTRATION

VERMIN ☐

SURCHARGE EVIDENT



DEPTH _____ mm

TOXIC ATMOSPHERE

**USE**FOUL ☐

SURFACE

WATER

COMBINED ☐WATERCOURSE ☐T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	4060				
(III) SIZE (mm)	1200				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
4120		
1200		
CONC		

DETAILS**OSGB LOCATION OF MANHOLE COVER**

Easting (X):

372633.4628

Northing (Y):

437233.4472

COMMENTS

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
16	PRO. AB. 14-A	SW



REFERENCE

55

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☒

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☐

COVER SHAPE



OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

600x600

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☒

ATTENTION REQUIRED

☐

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

2700mm

8 STEPS

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☐

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☐

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐

SURFACE

WATER

☒

COMBINED

☐

WATERCOURSE

☐

T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3980				
(III) SIZE (mm)	1200				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3960		
1200		
CONC		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372638.0368 Northing (Y): 437254.9751	offset INVERT (A)

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
17	PRO.AB.14-A	SW


REFERENCE SGHBDATE 25.09.2023LOCATION MITTON ROAD, WHALLEYCARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐**COVER SHAPE**

OTHER _____


HEAVY DUTY ☒MEDIUM DUTY ☐LIGHT DUTY ☐SIZE 1200 x 675**COVER CONDITION**OK ☒ATTENTION REQUIRED ☐**CHAMBER**

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK

ATTENTION REQUIRED

CHAMBER

OK

ATTENTION REQUIRED

BENCHING / CHANNEL

OK

ATTENTION REQUIRED

STEP IRONS / LADDER

OK

ATTENTION REQUIRED

SIZE 2700MM4 STEPS**CONSTRUCTION**BRICK ☐PRECAST ☒INSITU CONC. ☐PVC ☐OTHER ☒REFER TO DESIGN**SERVICE**

SILT / DEBRIS



DEPTH

mm

INFILTRATION



VERMIN



SURCHARGE EVIDENT

DEPTH

mm

TOXIC ATMOSPHERE

**USE**FOUL ☐

SURFACE WATER

COMBINED ☐WATERCOURSE ☐T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3110	3240			
(III) SIZE (mm)	1200	1200			
(IV) MATERIAL	CONC	CONC			
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3110		
300		
CLAY		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372646.9523 Northing (Y): 437299.6911	HYDROBRAKE UNIT NOT INSTALLED ON OUTLET (X) OFFSET INVERTS

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
18	PRO.AB.14-A	SW



REFERENCE

SGA

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY



FOOTPATH



VERGE



OUTSIDE HIGHWAY BOUNDARY

**COVER SHAPE**

OTHER

HEAVY DUTY



MEDIUM DUTY



LIGHT DUTY



SIZE

600 x 600

COVER CONDITION

OK



ATTENTION REQUIRED

**CHAMBER**

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK



ATTENTION REQUIRED



CHAMBER

OK



ATTENTION REQUIRED



BENCHING / CHANNEL

OK



ATTENTION REQUIRED



STEP IRONS / LADDER

OK



ATTENTION REQUIRED



SIZE

2700 mm

5 STEPS

CONSTRUCTION

BRICK



PRECAST



INSITU CONC.



PVC



OTHER

**SERVICE**

SILT / DEBRIS



DEPTH

mm

INFILTRATION



VERMIN



SURCHARGE EVIDENT



DEPTH

mm

TOXIC ATMOSPHERE

**USE**

FOUL



SURFACE

WATER



COMBINED



WATERCOURSE



T/EFFLUENT



CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)					
(III) SIZE (mm)					
(IV) MATERIAL					
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3220		
1200		
CONC		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372636.4483 Northing (Y): 437302.2878	offset INVERT (x)

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
19	PRO-AB.14-A	SW

REFERENCE

S7

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☐

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☒

COVER SHAPE


☒


OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

600x600

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☒

ATTENTION REQUIRED

☐

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

1350mm

8 STEPS

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☐

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☐

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐

SURFACE

WATER

☒

COMBINED

☐

WATERCOURSE

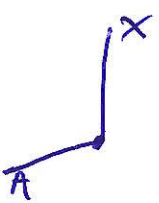
☐

T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	2920				
(III) SIZE (mm)	300				
(IV) MATERIAL	CLAY				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
2950		
300		
CLAY		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372654.1633 Northing (Y): 437298.6017	

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
20	PRO. AB. 14-A	JW



REFERENCE

S9

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☐

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☒

COVER SHAPE



OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

1200 x 675

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☒

ATTENTION REQUIRED

☐

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

1500 mm

4 STEPS

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☐

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☐

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐

SURFACE

WATER

☒

COMBINED

☐

WATERCOURSE

☐

T/EFFLUENT

☐

CHAMBER CONTENT

INCOMING PIPES

(I) PIPE

A

B

C

D

E

(II) DEPTH TO INV. (mm)

1780

1790

(III) SIZE (mm)

225

300

(IV) MATERIAL

CLAY

CLAY

(V) BACKDROP (mm)

OUTGOING PIPES

X

Y

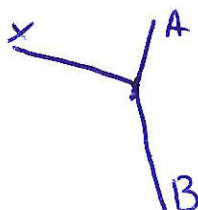
Z

1900

300

CLAY

DETAILS

OSGB LOCATION
OF MANHOLE COVER

Easting (X):

372661.6234

Northing (Y):

437336.4545

COMMENTS

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.

21

JOB NO.

PRO-AB.14-A

SURVEYOR

JW



REFERENCE

S8

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☐

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☒

COVER SHAPE

☒

OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

1200 x 675

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☒

ATTENTION REQUIRED

☐

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

1350 mm

3 STEPS

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☐

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☐

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐SURFACE
WATER☒

COMBINED

☐

WATERCOURSE

☐

T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	1580				
(III) SIZE (mm)	90				
(IV) MATERIAL	HPDE				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
1610		
225		
CLAY		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372662.0236 Northing (Y): 437340.1699	

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
22	PRO.AB.14-A	Sw

REFERENCE 510

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☐ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☒
COVER SHAPE


OTHER _____

HEAVY DUTY ☒

MEDIUM DUTY ☐

LIGHT DUTY ☐

SIZE 600 x 600
COVER CONDITION

OK ☒


ATTENTION REQUIRED ☐
CHAMBER

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK

ATTENTION REQUIRED

CHAMBER

OK

ATTENTION REQUIRED

BENCHING / CHANNEL

OK

ATTENTION REQUIRED

STEP IRONS / LADDER

OK

ATTENTION REQUIRED

SIZE 1350 MM
6 STEPS
CONSTRUCTION

BRICK ☐

PRECAST ☒

INSITU CONC. ☐

PVC ☐

OTHER ☐
SERVICE

SILT / DEBRIS



DEPTH _____ mm

INFILTRATION


VERMIN ☐

SURCHARGE EVIDENT

DEPTH _____ mm

TOXIC ATMOSPHERE


USE

FOUL ☐

SURFACE WATER

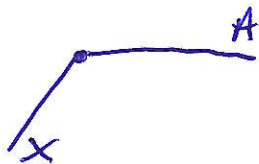

COMBINED ☐

WATERCOURSE ☐

T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	<u>2320</u>				
(III) SIZE (mm)	<u>300</u>				
(IV) MATERIAL	<u>CLAY</u>				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
<u>2350</u>		
<u>300</u>		
<u>CLAY</u>		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372598.2757</u> Northing (Y): <u>437356.4183</u>	

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>23</u>	<u>PRO-AB.14-A</u>	<u>SW</u>



REFERENCE

S11

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☒

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☐

COVER SHAPE



OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

1200 x 675

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☒

ATTENTION REQUIRED

☒

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

FLOODED

3000mm

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☐

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☐

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐

SURFACE

WATER

☒

COMBINED

☐

WATERCOURSE

☐

T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)					
(III) SIZE (mm)					
(IV) MATERIAL					
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
2630		
1350		
CONC		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
 X (OFFSET)	Easting (X): 372624.7702 Northing (Y): 437526.7841	OFFSET INVERT FLOODED CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
24	PRO-AB.14-A	JW

REFERENCE S12

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE



OTHER _____

HEAVY DUTY ☐ MEDIUM DUTY ☐ LIGHT DUTY ☐

SIZE 600 x 600

COVER CONDITION

OK ☐

ATTENTION REQUIRED ☐

CHAMBER

REGULATING COURSE OK ☐

ATTENTION REQUIRED ☒

SHAFT OK ☒

ATTENTION REQUIRED ☐

CHAMBER OK ☒

ATTENTION REQUIRED ☐

BENCHING / CHANNEL OK ☒

ATTENTION REQUIRED ☐

STEP IRONS / LADDER OK ☒

ATTENTION REQUIRED ☐

FLOODED

SIZE 3000 mm

CONSTRUCTION

BRICK ☐

PRECAST ☒

INSITU CONC. ☐

PVC ☐

OTHER ☐

SERVICE

SILT / DEBRIS ☐

DEPTH _____ mm

INFILTRATION ☐

VERMIN ☐

SURCHARGE EVIDENT ☒

DEPTH _____ mm

TOXIC ATMOSPHERE ☐

USE

FOUL ☐

SURFACE WATER ☒

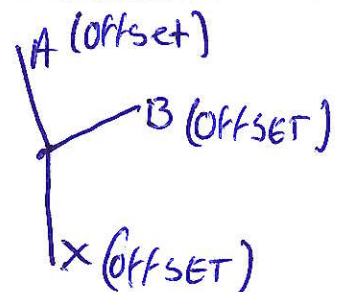
COMBINED ☐

WATERCOURSE ☐

T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3040	2890			
(III) SIZE (mm)	1350	750?			
(IV) MATERIAL	CONC	CONC			
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3200		
1350		
CONC		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372628.7549 Northing (Y): 437500.7141	OFFSET INVERTS FLOODED CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
25	PRO.AB.14-A	SW

REFERENCE S27

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE



OTHER _____

HEAVY DUTY ☒

MEDIUM DUTY ☐

LIGHT DUTY ☐

SIZE 1200 x 675

COVER CONDITION

OK ☒

ATTENTION REQUIRED ☐

CHAMBER

REGULATING COURSE OK ☒

ATTENTION REQUIRED ☐

SHAFT OK ☒

ATTENTION REQUIRED ☐

CHAMBER OK ☒

ATTENTION REQUIRED ☐

BENCHING / CHANNEL OK ☒

ATTENTION REQUIRED ☐

STEP IRONS / LADDER OK ☒

ATTENTION REQUIRED ☐

SIZE 2400 MM
CONCRETE SPOIL
2 STEPS

CONSTRUCTION

BRICK ☐

PRECAST ☒

INSITU CONC. ☐

PVC ☐

OTHER ☐

SERVICE

SILT / DEBRIS ☒

DEPTH _____ mm

INFILTRATION ☐

VERMIN ☐

SURCHARGE EVIDENT ☒

DEPTH _____ mm

TOXIC ATMOSPHERE ☐

USE

FOUL ☐

SURFACE WATER ☒

COMBINED ☐

WATERCOURSE ☐

T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)					
(III) SIZE (mm)					
(IV) MATERIAL					
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
<u>2130</u>		
<u>750</u>		
<u>CONC</u>		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
<u>x (offset)</u>	Easting (X): <u>372651.2616</u> Northing (Y): <u>437502.9806</u>	<u>OFFSET</u> <u>INVERT</u>

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>26</u>	<u>PRO.AB.14-A</u>	<u>SW</u>



REFERENCE

S13

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☒

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☐

COVER SHAPE



OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

600 x 600

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☐

ATTENTION REQUIRED

☒

SHAFT

OK

☒

ATTENTION REQUIRED

CHAMBER

OK

☒

ATTENTION REQUIRED

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

SIZE

FLOODED

3000 mm

4 STEPS

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☐

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☒

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐SURFACE
WATER☒

COMBINED

☐

WATERCOURSE

☐

T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3300				
(III) SIZE (mm)	1350				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3300		
1350		
CONC		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
A (offset) X (offset)	Easting (X): 372628.5771 Northing (Y): 437487.6626	offset INVERTS FLOODED CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
27	PRO-AB-14-A	SW



REFERENCE

S14

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY



FOOTPATH



VERGE



OUTSIDE HIGHWAY BOUNDARY



COVER SHAPE



OTHER

HEAVY DUTY



MEDIUM DUTY



LIGHT DUTY



SIZE

600x600

COVER CONDITION

OK



ATTENTION REQUIRED



CHAMBER

REGULATING COURSE

OK



ATTENTION REQUIRED



FLOODED

SHAFT

OK



ATTENTION REQUIRED



SIZE

3000 mm

CHAMBER

OK



ATTENTION REQUIRED



3 STEPS

BENCHING / CHANNEL

OK



ATTENTION REQUIRED



STEP IRONS / LADDER

OK



ATTENTION REQUIRED



CONSTRUCTION

BRICK



PRECAST



INSITU CONC.



PVC



OTHER



SERVICE

SILT / DEBRIS



DEPTH

mm

INFILTRATION



VERMIN



SURCHARGE EVIDENT



DEPTH

mm

TOXIC ATMOSPHERE



USE

FOUL



SURFACE

WATER



COMBINED



WATERCOURSE



T/EFFLUENT



CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3310				
(III) SIZE (mm)	1350				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3350		
1350		
CONC		

DETAILS

A (offset)

X (offset)

OSGB LOCATION
OF MANHOLE COVER

Easting (X):

372624.1744

Northing (Y):

437463.0262

COMMENTS

OFFSET INVERTS

FLOODED

CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
28	PRO-AB-14-A	JW



REFERENCE

S15

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY



FOOTPATH



VERGE



OUTSIDE HIGHWAY BOUNDARY



COVER SHAPE



OTHER

HEAVY DUTY



MEDIUM DUTY



LIGHT DUTY



SIZE

600 x 600

COVER CONDITION

OK



ATTENTION REQUIRED




CHAMBER

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK



ATTENTION REQUIRED



CHAMBER

OK



ATTENTION REQUIRED



BENCHING / CHANNEL

OK



ATTENTION REQUIRED



STEP IRONS / LADDER

OK



ATTENTION REQUIRED



SIZE

3000 mm

NO STEPS

CONSTRUCTION

BRICK



PRECAST



INSITU CONC.



PVC



OTHER



SERVICE

SILT / DEBRIS



DEPTH

mm

INFILTRATION



VERMIN



SURCHARGE EVIDENT

DEPTH

mm

TOXIC ATMOSPHERE



USE

FOUL

SURFACE
WATER

COMBINED



WATERCOURSE



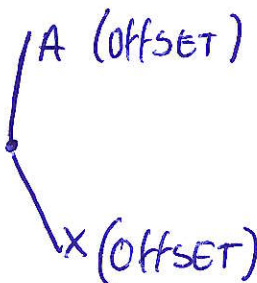
T/EFFLUENT



CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3200				
(III) SIZE (mm)	1350				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3530		
1350		
CONC		

DETAILS

OSGB LOCATION
OF MANHOLE COVER

Easting (X):

372624.1979

Northing (Y):

437455.7973

COMMENTS

OFFSET INVERTS
FLOODED
CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
29	PRO-AB14-A	SW

REFERENCE 516DATE 25.09.2023LOCATION MITTON ROAD, WHALLEYCARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐**COVER SHAPE**

OTHER _____

HEAVY DUTY ☒MEDIUM DUTY ☐LIGHT DUTY ☐SIZE 600x600**COVER CONDITION**OK ☒ATTENTION REQUIRED ☐**CHAMBER**

REGULATING COURSE OK

☐

ATTENTION REQUIRED

☒FLOODED

SHAFT OK

☒

ATTENTION REQUIRED

☐SIZE 3000 mm

CHAMBER OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER OK

☒

ATTENTION REQUIRED

☐5 STEPS**CONSTRUCTION**BRICK ☐PRECAST ☒INSITU CONC. ☐PVC ☐OTHER ☐**SERVICE**

SILT / DEBRIS

☒

DEPTH _____ mm

INFILTRATION

☐VERMIN ☐

SURCHARGE EVIDENT

☒

DEPTH _____ mm

TOXIC ATMOSPHERE

☐**USE**FOUL ☐

SURFACE WATER

☒COMBINED ☐WATERCOURSE ☐T/EFFLUENT ☐


CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3500				
(III) SIZE (mm)	1350				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3560		
1350		
CONC		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372637.3358</u> Northing (Y): <u>437433.2121</u>	<u>offset INVERTS</u> <u>FLOODED</u> <u>CHAMBER</u>

Disclaimer: Condition Survey
 – to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>30</u>	<u>PRO-AB-14-A</u>	<u>SW</u>

REFERENCE S17DATE 25.09.2023LOCATION MITTON ROAD, WHALLEYCARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐**COVER SHAPE**

OTHER _____

HEAVY DUTY ☒MEDIUM DUTY ☐LIGHT DUTY ☐

SIZE _____


COVER CONDITIONOK ☒ATTENTION REQUIRED ☐**CHAMBER**

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK

ATTENTION REQUIRED

CHAMBER

OK

ATTENTION REQUIRED

BENCHING / CHANNEL

OK

ATTENTION REQUIRED

STEP IRONS / LADDER

OK

ATTENTION REQUIRED

FLOODEDSIZE 3000 mm6 STEPS**CONSTRUCTION**BRICK ☐PRECAST ☒INSITU CONC. ☐PVC ☐OTHER ☐**SERVICE**

SILT / DEBRIS



DEPTH _____ mm

INFILTRATION



VERMIN



SURCHARGE EVIDENT

DEPTH _____ mm

TOXIC ATMOSPHERE

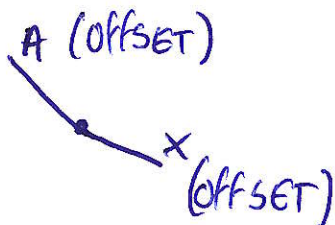
**USE**FOUL ☐

SURFACE WATER

COMBINED ☐WATERCOURSE ☐T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	<u>3700</u>				
(III) SIZE (mm)	<u>1350</u>				
(IV) MATERIAL	<u>CONC</u>				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
<u>3900</u>		
<u>1350</u>		
<u>CONC</u>		

DETAILS**OSGB LOCATION OF MANHOLE COVER**

Easting (X):

372646.1710

Northing (Y):

437425.9294**COMMENTS**OFFSET INVERTS
FLOODED
CHAMBERDisclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>31</u>	<u>PRO.AB.14-A</u>	<u>JW</u>



REFERENCE

S23

DATE

25.09.2023

LOCATION

MITTON ROAD, WHALLEY

CARRIAGEWAY

☒

FOOTPATH

☐

VERGE

☐

OUTSIDE HIGHWAY BOUNDARY

☐

COVER SHAPE



OTHER

HEAVY DUTY

☒

MEDIUM DUTY

☐

LIGHT DUTY

☐

SIZE

600x600

COVER CONDITION

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

REGULATING COURSE

OK

☐

ATTENTION REQUIRED

☐

SHAFT

OK

☒

ATTENTION REQUIRED

☐

CHAMBER

OK

☒

ATTENTION REQUIRED

☐

BENCHING / CHANNEL

OK

☒

ATTENTION REQUIRED

☐

STEP IRONS / LADDER

OK

☒

ATTENTION REQUIRED

☐

SIZE

Flooded

3000 mm

CONSTRUCTION

BRICK

☐

PRECAST

☒

INSITU CONC.

☐

PVC

☐

OTHER

☐

SERVICE

SILT / DEBRIS

☒

DEPTH

mm

INFILTRATION

☐

VERMIN

☐

SURCHARGE EVIDENT

☒

DEPTH

mm

TOXIC ATMOSPHERE

☐

USE

FOUL

☐SURFACE
WATER☒

COMBINED

☐

WATERCOURSE

☐

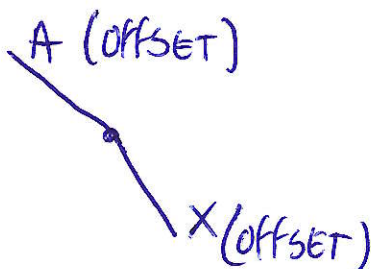
T/EFFLUENT

☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3820				
(III) SIZE (mm)	1350				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3830		
1350		
CONC		

DETAILS

OSGB LOCATION
OF MANHOLE COVER

Easting (X):

372661.6624

Northing (Y):


437420.0935

COMMENTS

OFFSET INVERTS
FLOODED
CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
32	PRO.AB.14-A	JW

REFERENCE S24DATE 25.09.2023LOCATION MITTON ROAD, WHALLEYCARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐**COVER SHAPE**

OTHER _____

HEAVY DUTY ☒MEDIUM DUTY ☐LIGHT DUTY ☐SIZE 600 x 600**COVER CONDITION**OK ☒ATTENTION REQUIRED ☐**CHAMBER**REGULATING COURSE OK ☐ATTENTION REQUIRED ☒FLOODEDSHAFT OK ☒ATTENTION REQUIRED ☐CHAMBER OK ☒ATTENTION REQUIRED ☐SIZE 3000MMBENCHING / CHANNEL OK ☒ATTENTION REQUIRED ☐STEP IRONS / LADDER OK ☒ATTENTION REQUIRED ☐6 STEPS**CONSTRUCTION**BRICK ☐PRECAST ☒INSITU CONC. ☐PVC ☐OTHER ☐**SERVICE**SILT / DEBRIS ☐

DEPTH _____ mm

INFILTRATION ☐VERMIN ☐SURCHARGE EVIDENT ☒

DEPTH _____ mm

TOXIC ATMOSPHERE ☐**USE**FOUL ☐

SURFACE

WATER ☒COMBINED ☐WATERCOURSE ☐T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	4000				
(III) SIZE (mm)	1350				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
4090		
1350		
CONC		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372664.3212</u> Northing (Y): <u>437410.6934</u>	<u>OFFSET INVERTS</u> <u>FLOODED</u> <u>CHAMBER</u>

Disclaimer: Condition Survey
 – to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>33</u>	<u>PRO. AB 14-A</u>	<u>SW</u>

REFERENCE S25 H13DATE 25.09.2023LOCATION MITTON ROAD, WHALLEYCARRIAGEWAY ☐ FOOTPATH ☐ VERGE ☒ OUTSIDE HIGHWAY BOUNDARY ☐**COVER SHAPE**

OTHER _____


HEAVY DUTY ☒MEDIUM DUTY ☐LIGHT DUTY ☐SIZE 1200 x 675**COVER CONDITION**OK ☒ATTENTION REQUIRED ☐**CHAMBER**

REGULATING COURSE

OK



ATTENTION REQUIRED



SHAFT

OK

ATTENTION REQUIRED

CHAMBER

OK

ATTENTION REQUIRED

BENCHING / CHANNEL

OK

ATTENTION REQUIRED

STEP IRONS / LADDER

OK

ATTENTION REQUIRED

SIZE 3000mm10 STEPS**CONSTRUCTION**BRICK ☐PRECAST ☒INSITU CONC. ☐PVC ☐OTHER ☒REFER TO DESIGN**SERVICE**SILT / DEBRIS ☐

DEPTH

mm

INFILTRATION ☐VERMIN ☐SURCHARGE EVIDENT ☒

DEPTH

mm

TOXIC ATMOSPHERE ☐**USE**FOUL ☐

SURFACE

WATER ☒COMBINED ☐WATERCOURSE ☐T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	4730				
(III) SIZE (mm)	1350				
(IV) MATERIAL	CONC				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
?		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): 372666.3450 Northing (Y): 437384.1774	HYDROBRAKE UNIT NOT INSTALLED on outlet (x) FLOODED CHAMBER

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
34	PRO. AB. 14-A	JW

REFERENCE EXMH5312

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☒ FOOTPATH ☐ VERGE ☐ OUTSIDE HIGHWAY BOUNDARY ☐

COVER SHAPE ☐ ☒ ☐ ☐ ☐ ☐ OTHER _____

HEAVY DUTY ☒ MEDIUM DUTY ☐ LIGHT DUTY ☐ SIZE 600 x 600

COVER CONDITION OK ☒ ATTENTION REQUIRED ☐ _____

CHAMBER

REGULATING COURSE	OK	☒	ATTENTION REQUIRED	☐	SIZE <u>REFER TO UU RECORDS</u>
SHAFT	OK	☒	ATTENTION REQUIRED	☐	
CHAMBER	OK	☒	ATTENTION REQUIRED	☐	
BENCHING / CHANNEL	OK	☒	ATTENTION REQUIRED	☐	
STEP IRONS / LADDER	OK	☒	ATTENTION REQUIRED	☐	

CONSTRUCTION

BRICK ☐ PRECAST ☒ INSITU CONC. ☐ PVC ☐ OTHER ☐ _____

SERVICE

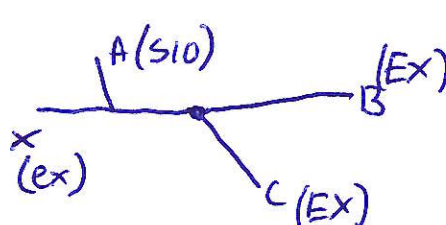
SILT / DEBRIS ☐ DEPTH _____ mm INFILTRATION ☐ VERMIN ☐
SURCHARGE EVIDENT ☐ DEPTH _____ mm TOXIC ATMOSPHERE ☐

USE

FOUL ☐ SURFACE WATER ☒ COMBINED ☐ WATERCOURSE ☐ T/EFFLUENT ☐

CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	2340	2470	2330		
(III) SIZE (mm)	300	300	150		
(IV) MATERIAL	CLAY	CLAY	CLAY		
(V) BACKDROP (mm)	N/A	N/A	N/A		

OUTGOING PIPES		
X	Y	Z
2450		
300		
CLAY		
N/A		

DETAILS	OSGB LOCATION OF MANHOLE COVER	COMMENTS
	Easting (X): <u>372596.9570</u> Northing (Y): <u>437354.2487</u>	(A) INCOMING FROM SIO

Disclaimer: Condition Survey
– to be used as a guide only

SHEET NO.	JOB NO.	SURVEYOR
<u>35</u>	<u>PRO-AB-14-A</u>	<u>SW</u>

REFERENCE EXMH5202

DATE 25.09.2023

LOCATION MITTON ROAD, WHALLEY

CARRIAGEWAY ☐ FOOTPATH ☐ VERGE ☒ OUTSIDE HIGHWAY BOUNDARY ☐
COVER SHAPE


OTHER _____

HEAVY DUTY ☒ MEDIUM DUTY ☐ LIGHT DUTY ☐

SIZE 600 x 600
COVER CONDITION

OK ☒

ATTENTION REQUIRED ☐
CHAMBER

REGULATING COURSE OK

SHAFT OK

CHAMBER OK

BENCHING / CHANNEL OK

STEP IRONS / LADDER OK



ATTENTION REQUIRED

ATTENTION REQUIRED

ATTENTION REQUIRED

ATTENTION REQUIRED

ATTENTION REQUIRED


SIZE REFER TO UU RECORDS
10 STEPS
CONSTRUCTION

BRICK ☐

PRECAST ☒

INSITU CONC. ☐

PVC ☐

OTHER ☐
SERVICE

SILT / DEBRIS



SURCHARGE EVIDENT

DEPTH _____ mm

DEPTH _____ mm

INFILTRATION



TOXIC ATMOSPHERE

VERMIN


USE

FOUL



SURFACE WATER



COMBINED



WATERCOURSE



T/EFFLUENT



CHAMBER CONTENT	INCOMING PIPES				
(I) PIPE	A	B	C	D	E
(II) DEPTH TO INV. (mm)	3570				
(III) SIZE (mm)	150				
(IV) MATERIAL	CLAY				
(V) BACKDROP (mm)					

OUTGOING PIPES		
X	Y	Z
3580		
225		
CLAY		

DETAILS 	OSGB LOCATION OF MANHOLE COVER Easting (X): <u>372598.4629</u> Northing (Y): <u>437264.1490</u>	COMMENTS
---	--	-----------------